

STATE OF MICHIGAN
 COUNTY OF OCEANA
 RECEIVED FOR RECORD

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

3 DEC 1999 2:14:00 PM

For corners in

Oceana (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>15NR 17W</u>	<u>I-9</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

JOSEPH E. HERTEN
 REGISTER OF DEEDS

100949

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, J. Randolph Hepworth in a field survey on October 12, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-9 CORNER COMMON TO SECTIONS 22, 23, 26, AND 27 T15N, R17W HART TOWNSHIP

GLO J. Mullett 1838 SET POST 15" Beech S26°E (25 lks) 16.5' 20" Beech N66°W (62 lks) 40.9'

Book A, Pg. 130, S Edson, 1882; "A Gray stone shaped some like an Indian arrow, 7 inches long with a bent side facing the South. Also, cedar post hewed square with the figures-22, 23, 26 & 27 facing those sections. 1) 14" Cherry Stump S65°E 36' "

Book A, Pg. 176, EM Hyde, 1887; Corner not Witnessed.

Book A, Pg. 184, EM Hyde, 1887; "A large stone in the center of the highway corner to Sections 22, 23, 26, & 27."

Unrecorded Survey, JR Hepworth #26457, 3/25/88 FD Lg Spike Replaced w/ 1/2" X 2' IR
 2) 8" Tw Cherry 4°az 57.85' 3) P Pole 156°az 52.33'

4) 6" Cherry 117°az 59.56'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

I found a JRH 1/2" Iron and cap in the centerline of east-west road and on standing fence to the south. Upon excavation, I found it to be beside a gray stone "shaped like an indian arrow" 3"x8"x16" with the flat side facing north and the "bent" or rounded or rougher side facing south. This corner is substantially as described by Edson, 1882. I did not find any evidence of the cedar post.

I accept the Iron and stone as the best available evidence of the position of the original corner. No evidence is known to me that would lead me to believe the corner should be at another location.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Set 4"x20" Harrison Cast Iron Monument, stamped "County Surveyor" and "26457" above the 1/2" Iron which was driven down. I placed the stone back in the hole.

3) 60d spk	E Face	Power Pole	152°az	52.26'	EDM
4) 60d spk	SW Face	16" Cherry	113 az	30.56'	EDM
60d spk	NW Face	6" W Pine	236°az	51.41'	EDM
80d spk	E Face	10" clp Maple	North	63.23'	EDM

Oceana County Remonumentation
 Peer Group Reviewed & Approved

Date: 11-11-99

J. Randolph Hepworth
 Oceana County Surveyor

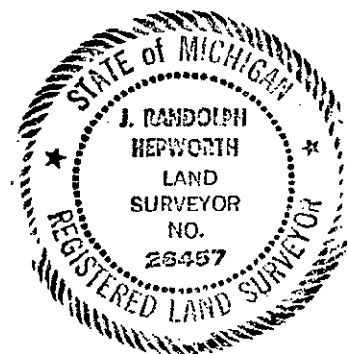

Signed by J. Randolph Hepworth
 Surveyor's Michigan License No. 26457

Date November 30, 1999