

FEB 25 1994 LAND CORNER RECORDATION CERTIFICATE

COMMISSION

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

| FOR CORNERS OF--:                                   | LOCATED IN--:                 | CORNER CODE NUMBER |
|---|-------------------------------|--------------------|
| 1. PUBLIC LAND SURVEY _____ T. _____                | 16N N. 15W S., R. _____ E. W. | A1                 |
| 2. PROPERTY CONTROLLING IN SECTION _____ T. _____   | N. S., R. _____ E. W.         |                    |
| 3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ | N. S., R. _____ E. W.         |                    |
| 4. LOT NO. _____, RECORDED PLAT _____               |                               |                    |
| 5. PRIVATE CLAIMS _____                             |                               |                    |

STATE OF MICHIGAN COUNTY OF OCEANA RECEIVED FOR RECORD

93 DEC 14 AM 10:23

REGISTER OF DEEDS REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram-over) were, in a field survey on August 23 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Section corner common to sections 31 of T17N R15W, section 36 of T17N R16W, section 6 of T16N R15W and section 1 of T16N R16W.

- |   |   |   |
|---|---|---|
| 1835 survey by Mullett & Brookfield<br>Set Wood Post<br>#1 Maple 9 S35W 35 links<br>#2. Y.Pine 18 N63E 21 links | 1940 field notes of H.Arnouts (USFS)<br>Monument is an ironstake.<br>#5. Maple 15 N1/2E 101 links<br>#6. W.Oak 10 S33W 121 links<br>#7. Fence Cor. Post S83W 47 links | 1972 survey by Robert A. Griffin<br>Fd. a 3" diam.cast iron pump base replaced w/ a 5" sq.x 60" long conc. monu. w/brass cap.<br>#4. W.Pine Stp. 30 N50W 52.8 ft.<br>#7. Fn. Cor. Post S78W 31.30 ft.<br>#9. Tw.W.Oak 9x16 N41W 69.07'<br>#10. P.Post 4'x7' North 1.2 ft. |
| 1909 survey by C.Landon<br>No Monument mentioned<br>#3. W.Pine 22 N33E 70 links<br>#4. W.Pine 30 N50W 80 links  | 1980 survey by Durlap #21759<br>Fd. conc. monu. by Griffin<br>#8. Oak 40 S60E 67.31 feet  |   |

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the 5" square by 36" long concrete monument w/ brass cap by Griffin destroyed. The base was still intact and I removed the brass cap and placed it beneath the new monument I set. Liber 1 Page 189 by Griffin documents the history of this corner. Witness numbers 5, 6, 8 and 9 are still available, all others are gone. Witness 8 is not an Oak. It is a cottonwood.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Section corner common to sections 31 of T17N R15W, section 36 of T17N R16W, section 6 of T16N R15W and section 1 of T16N R16W.

Monu. Placed a 2"x30" Galvanized Iron Pipe w/ 3" brass disk, buried 4" below the surface.

- Witnesses:
- |                            |  |
|----------------------------|--|
| Tw.B.Oak 9x12 S64W 36.16'  | Tw.W.Oak 20x30 N45W 69.07'   |
| R.Maple 30 N3W 67.27'      | This corner is 10 feet East of the centerline of the road to the south, 47 feet West of the centerline of the curve to the NE, 22 feet West of the centerline of a 2-track to the North and S60E 29 feet from a road closure berm. |
| R.Pine 10 N24E 93.08'      |  |
| R.Oak 7 N83E 96.33'        |  |
| Fiberglass Post West 25.5' |  |

Date: 11-18-93 J. Randolph Hepworth Oceana County Surveyor


SIGNED BY Patrick R. Leemon DATE November 19, 1993

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_ CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_ MICHIGAN REGISTERED LAND SURVEYOR

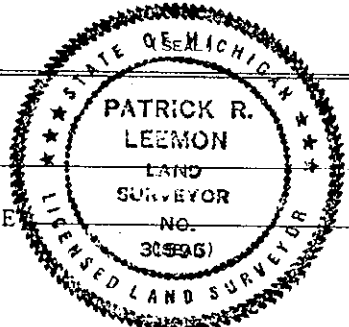

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_