

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 16 N. R. 18 W.	K-12; K-13; L-13; M-12
2. PROPERTY CONTROLLING IN SECTION 36	T. 16 N. R. 18 W.	15; 16
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. S. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER _____

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 16, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

= = = = = C. (continued)

M-12	15	16
Fd. 2 1/2" Axle shaft in Ctr. N-S rd.	Set 1/2"x3/8"x21" iron & ced.post w/loc. tag	Set 3/8"x1/4"x16" iron & cedar post w/loc. tag
8" N. Pine N70°E 43.35	5" R. Maple N30°W 34.0	5" W. Pine N55°W 37.7
12" Oak S85°W 43.70	6" R. Maple N55°E 15.8	14" R. Pine N65°E 46.4
8" N. Pine N55°W 57.33	W 1/16 on N line Sec. 1	E 1/16 on N line Sec. 1
Set ced.post w/loc. tag Due E 33'	T15N-R18W S87°53'E 24.75	T15N-R18W S87°53'E 8.25

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- K-12 Reestablished 1/4 corner equidistant & on line between NW & SW corners of Sec. 36.
 - K-13 Reestablished SW corner of Sec. 36 on line & at proportionate measurement to U.S. between the SE Cor. 5, 36 & the N 1/4 corner of Sec. 2 (T15N-R18W).
 - L-13 Reestablished S 1/4 Sec. 36 equidistant & on line between SE & SW corners of Sec. 36.
 - M-12 Found E 1/4 corner of Sec. 36 as established by MSHD per their witnesses as listed in item C.
 - 15 Established 1/16 corner equidistant & on line between S 1/4 & SW corners of Sec. 36.
 - 16 Established 1/16 corner equidistant & on line between S 1/4 & SE corners of Sec. 36.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-12	K-13	L-13
Set DNR monument & cedar post	Set DNR monument & cedar post	Set DNR monument & cedar post
7" R. Pine N45°W 49.0	6" B. Oak N25°W 11.7	7" R. Oak N60°W 48.6
8" R. Pine N25°E 34.5	3" W. Pine N35°E 10.5	7" R. Oak N40°E 23.0
8" R. Pine S75°E 67.2	NW Sec. 1 T15N-R18W S87°53'E 53.00	N 1/4 Sec. 1 T15N-R18W S87°53'E 16.50
		& N-S Trail West 12'±

SIGNED BY Carl F. Roser DATE 5-23-79


SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____
 PENTWATER TOWNSHIP
 OCEANA COUNTY

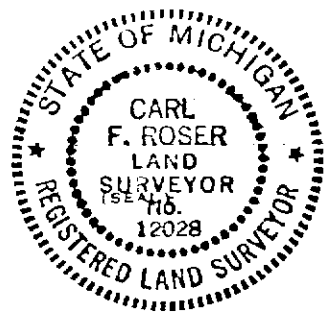

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET