

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 16 N. R. 18 W.	L-10; M-10
2. PROPERTY CONTROLLING IN SECTION 25	T. 16 N. R. 18 W.	9
3. MISCELLANEOUS PROPERTY IN SECTION 25	T. 16 N. R. 18 W.	ZZ = 858' S of #9
4. LOT NO. _____	RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 11, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on June 20, 1979, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. = Description of original monument and accessories and for subsequent restoration:~~

C. (continued)

	ZZ	
Set 5/8"x34" rerod & ced. post w/loc. tag		
10" W. Pine	N80°W	17.35
9" W. Pine	S25°E	20.50
Fd. 1" pipe	S60°W	8.63
Fd. 1 1/2" pipe	N05°W	21.30
Q. Wayne Road	Due E	151'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- L-10 Fd. & accepted 1/2" rerod by RLS Sammy Barnett.
- M-10 Fd. 3/4"x19" pipe & 2 oak wit. trees; fits old survey of record at Co. Surveyor's Office, Hart; Book A, page 479, dated 1929.
- 9 Set 5/8" rerod at NW corner of NE 1/4-SE 1/4 of Sec. 25; equidistant & on line between old E 1/4 corner (1929) and S. Barnett's center of Sec. 25.
- ZZ Established the SW corner of the N 13 chains (858') of the NE 1/4-SE 1/4 of Sec. 25 per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-10	M-10	9
Fd. 1/2" rerod w/RLS cap; added cedar post w/loc. tag	Fd. 3/4"x19" pipe; added DNR monument & cedar post	Set 5/8"x34" rerod & ced. post w/loc. tag
9" B. Oak N40°W 34.80	24" R. Oak Due N 13.1	2" W. Pine N30°E 14.09
9" W. Oak Due N 12.39	11" Cedar N50°E 26.9	8" W. Pine S70°E 19.62
7" B. Oak S40°E 17.70	13" W. Ash N85°E 25.3	Fd. old 1 1/2" well point
Fd. well pt. S70°16'E 35.12	30" R. Oak S40°W 42.0	S81°34'E 18.10
Ctr. N-S trail Due E 62'	River flats Due W 64'	

SIGNED BY Carl F. Roser 5-14-80 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

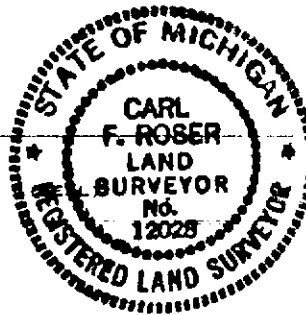

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

PENTWATER TOWNSHIP
OCEANA COUNTY