

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 16 N. R. 18 W.	K-10
2. PROPERTY CONTROLLING IN SECTION 25	T. 16 N. R. 18 W.	3; 5
3. MISCELLANEOUS PROPERTY IN SECTION 25	T. 16 N. R. 18 W.	XX = 669' S of #3
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 26, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on June 21, 1979, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and for subsequent restoration:~~

C. (continued)

XX

Set 5/8"x40" rerod		
6" W. Pine	N35°W	33.85
11" R. Oak	S85°W	13.90
18" R. Oak	N40°E	12.09
Set cedar post w/loc. tag		
Due W		16½'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-10 Fd. 1" pipe that fits 1929 C. Stover survey & wits. & fits 3 RLS Clint Cole wits.
- 3 Fd. 4" conc. plat mon. for N 1/8 corner on W line of Sec. 25.
- 5 Fd. & accepted RLS Sammy Barnett's N 1/8 corner on N-S ¼ line of Sec. 25.
- XX Established NW corner of SW¼-SW¼-NW¼ of Sec. 25 per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-10	3	5
Fd. 1"x38" pipe; added DNR mon. & cedar post	Fd. 4" round conc. mon. w/½ rerod; added ced. post	Fd. ½" rerod; added cedar post w/loc. tag
14" R. Oak N40°E 46.12	w/loc. tag	9" Hemlock N80°E 20.03
21" R. Oak N65°E 31.54	3" W. Pine N30°E 14.27	13" Maple Due S 2.27
10" R. Oak S85°W 43.85	6" W. Oak S75°E 22.82	Fd. axle shaft
	Ctr. crooked 2-track NW & SE is S45°W 37'	S76°21'W 18.75

SIGNED BY Carl F. Roser 5-14-80 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

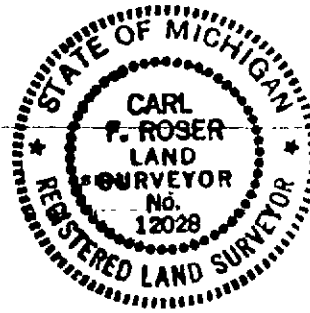

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

PENTWATER TOWNSHIP
OCEANA COUNTY