## SURVEY & - REMONUMENTATION

OCT 27 1993

## COMMISSION

4. Lot No. \_\_\_\_\_, Recorded Plat \_

STATE OF MICHIGAN COUNTY OF OCEANA RECEIVED FOR PECORD

RECEIVED FOR RECORD 100495

93 DCT -7 P2:44

## OCEANA COUNTY REMONUMENTAITON LAND CORNER RECORDATION CERTIFICATE


Filing Requirement of Act 74, Mich. P.A. 1970

Fo	r corners in	•	,	A
	OCEANA (County)	Located In:	Corner Code ≠	Jung & mertins REGISTER OF DEEDS
1.	Public Land Survey	T <u>16N</u> R <u>18W</u> T R T R T R	L-7.	
2.	Property Controlling in Section	S T R S T R		
3.	Miscellaneous Property in Sec.	S T R S T R		Register of Deeds Stamp & File Number

5.	Private Claims _	 		 	

I, J. Randolph Hepworth September 28, 1993 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

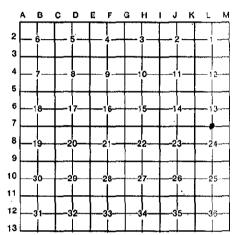

A. Description of original monument and accessories and/or subsequent restoration:

L-7 1/4 CORNER COMMON TO SEC 13 & 24 PENTWATER TWP T16N, R18W N10°E 6° W PINE S35°W GLO SET POST 24" W PINE 31.61 BOOK A - 370 HA GRANT, JUNE, 1894 9" HENLOCK 18" GRATE BAR N62ºE 4" PINE 10.9 \$3210B 19.1" OCRC WITNESS = MDOT WITNESS FD 1"X3"X1 1/2" GRATE BAR LCRC # 100053 MDOT 10" MAPLE 19" OAK #10°E 17.67 28" OAK N500W 33.781 S380E LCRC # 100443 R. HEPWORTH, LS 26457 1-7-91 FD GRATE BAR 28\* OAK ..... N10°B 17.62 10" TW BIRCH N80°W 27.87 14" TW OAK S40°E 48.95 12" MAPLE S25°E 26.29

B.Description of corner evidence found and/or method applied in restoring or reestablishing corner

FOUND 1"X3"X1 1/2" GRATE BAR AS PER LCRC #100053 AND #100443 AND IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

L-7 1/4 CORNER COMMON TO SEC 13 & 24 PENTWATER TWP T16N, R18W
SET "COUNTY SURVEYOR" HARRISON 4"X20" CAST IRON MONUMENT ON TOP OF FOUND 1"X3"X1 1/2" GRATE BAR

60d SPK	E FACE 28" OAK	N10°B 17.62	TAPED
60d SPK	NE FACE 14" TW OAK	N10°B 17.62	TAPED
60d SPK	NE FACE 12" MAPLE	S25°E 26.29	TAPED -
60d SPK	NE PACE 16" MAPLE	S15°E 43.88	TAPED '
60d spr	NE FACE 36° DAK	и50°W 33.78	TAPED



Signed by Surveyor's Michigan License No. 26457

October 6, 1993

Date \_\_\_\_

1900