

APR 08 1999

Ogemaw County Remonumentation

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

_____ Ogemaw _____ (County)	Located in:	Corner Code #
1. Public Land Survey	T21N R01E	A-2
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

LIBER 3 PAGE 198
STATE OF MICHIGAN
OGEMAW COUNTY
RECORDED

23 DEC 1998 3:45:20 PM

WANDA MUZIK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Timothy L Lapham, in a field survey on September, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mention in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate

	A	B	C	D	E	F	G	H	I	J	K	L	M	
1														
2	6			5			4			3			2	1
3														
4	7			8			9			10			11	12
5														
6	18			17			16			15			14	13
7														
8	19			20			21			22			23	24
9														
10	30			29			28			27			26	25
11														
12	31			32			33			34			35	36
13														

A. Description of original monument and accessories and/or subsequent restoration:

A-2: GLO 1838 J Brink set post
White Oak 10 S53-1/2W 31
White Oak 10 N62W 10

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


A-2: Found large spike 3'+/- East of centerline of trail road (fire trail) at post to East, tree with wire in it to East and remains of old post to West. No evidence of GLO corner found. Rejected found spike due to lack of history. Decided to set corner by single proportionate measure between accepted A-1 and A-3 of T21N R1E. Accepted SPM corner position as best available method of reestablishing corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-2: Set 5/8"x36" rod with aluminum Ogemaw county remonumentation cap witnesses:
West 2'+/- centerline of north and south trail
S76E 4.50 spike in north face of cedar post
S33W 30.05 spike in SE face of 14" oak
S48E 14.69 spike in NE face of 18" oak
S79W 33.58 spike in S face of 18" poplar
N43E 15.72 spike in NW face of 18" oak

Approved by Peer Review

12/15/98 DATE INITIALS

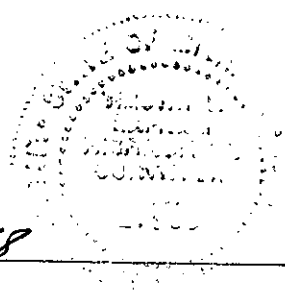

Signed by Timothy L. Lapham
Surveyor's Michigan License No. 27595

Date 12/23/1998