

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF -:	LOCATED IN -:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 22 ^{N.} R. 3 ^{E.}	M-8; L-6; K-7; L-7
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Kenneth J. Ostling, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 21, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

XX

C. Continued:

<p style="text-align: center;">K-7</p> <p>Left 1" iron bolt in place</p> <p>Nail in 30" Elm stump S88°W 16.67'</p> <p>Nail in 18" Maple S30°W 78.18'</p>	<p style="text-align: center;">L-7</p> <p>Set 1 1/2" pipe and cedar post</p> <p>8" Tamarack S73°W 32.65'</p> <p>2" Maple S52°E 17.33'</p>
--	---

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- M-8 Set corner on line over N1/8 and section corner North, at proportionate measurement between section corners. Falls about 2' north of fence line East.
- L-6 Set at calculated intersection of true 1/4 lines, per standard survey procedure.
- K-7 Found 1" bolt in E road as found and accepted in previous survey by James Richardson. Fell in line with old fence and was considered acceptably located in previous survey.
- L-7 Set corner by proportionate measurement between section corners. No evidence of a previous corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p style="text-align: center;">M-8</p> <p>Set DNR mon.</p> <p>Nail in fence post S78°E 31.4'</p> <p>Nail in 4" Apple N07°W 146.0'</p>	<p style="text-align: center;">L-6</p> <p>Set 5/8" rod w/RLS cap</p> <p>18" Maple S57°E 41.2'</p> <p>24" Maple S51°W 73.7'</p>
---	--

SIGNED BY *Kenneth J. Ostling* SURVEYOR'S MICHIGAN REGISTRATION NO. 10068

DATE 3/12/81

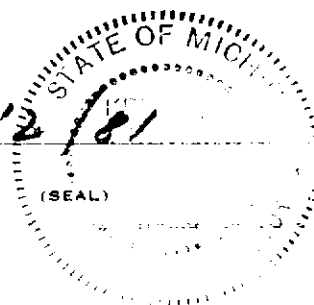

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ OGEMAW COUNTY

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET