

SURVEY & REMONUMENTATION

APR 29 1996

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Ogemaw
(County)

COMMISSION

	Located In:	Corner Code #
1. Public Land Survey	T <u>23NR 2E</u>	<u>C-1</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

LIBER 3 PAGE 27

STATE OF MICHIGAN
 Ogemaw County
 RECORDED

28 DEC 95 3:21 P.M.

WANDA MUZIK
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	16	17	18	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Timothy L. Lapham, in a field survey on December, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-1: GLO Mullett 1846, Set Post, 8" Spr. Pine S41W 49lnks, 6" Spr. Pine S34E 49lnks; LCRC Ostling 9/4/80(Rec 1-222, 11/18/80), Set 5/8" Rod, 2 Wits; LCRC Lapham 2/2/89(Rec 2-39, 3/22/89), Found Ostling Corner, 6 Wits; Survey Lapham 10/1/92(Rec 5-291), Found Steel Stake, Reference LCRC 2-39


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-1: No evidence of GLO survey Found. Found 5/8" capped iron in accord with recorded LCRC's. Accepted found corner as best evidence of accepted corner position. See dossier for additional information.

APPROVED BY
 PEER REVIEW
 12/11/95
 DATE P.A. 345 OF 1990

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-1: Set 5/8"X36" reroed with 3-1/4" Aluminum Ogemaw Remon cap marked "27595 1995"
 From Which:
 N54E 63.67' Spike in Guy Pole
 East 15' Centerline Roads N-S-E-W
 East 14.50' 5/8" Remon Monument
 S11W 80.05' Power Pole w/spike
 N55W 99.92' SE Cor of House
 N12W 33.29' DNR tag in Power Pole

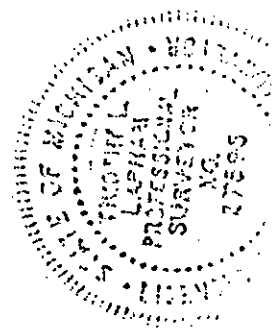

Signed by [Signature]
 Surveyor's Michigan License No. 27595

Date 12/28/95