

**SURVEY &
REMONUMENTATION**

MAY 03 1995

COMMISSION

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>OGEMAW</u> (County)	Located In: _____	Corner Code \neq _____
1. Public Land Survey	T <u>23N</u> R <u>3E</u>	<u>A-1</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	<u>Seg. #1</u>
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

LIBER

2 PAGE 252

STATE OF MICHIGAN
OGEMAW COUNTY
RECORDED

3 JAN 95 9:32 A.M.

WANDA MUZIK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Timothy L. Lapham, in a field survey on December, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

A-1: GLO, 1838 CLASON, POST, Y. BIRCH 22" S58W, 30LKS,
HEMLOCK 20", N54E, 59LKS;
WEEKS, PLAT OF ROSE CITY, 1-16, AUG 1892, NO CORNER MATERIAL, NO WITS
CONSUMERS POWER UNRECORDED SURVEY, FOUND BOAT SPIKE, 4 WITS
CALDWELL SURVEY, 1-172, 5/16/72, NO CORNER MATERIAL, NO WITS
CALDWELL SURVEY, 1-273, 5/23/73, FD 1/2" BAR, NO WITS
CALDWELL SURVEY, 3-121, 7/2/79, NO CORNER MATERIAL, NO WITS
GRANGER SURVEY, 5-388, 9/23/93, FND CAPPED IRON, 4 WITS


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
A-1: FOUND 1/2" IRON 2.5' WEST OF ROAD NORTH IN ACCORD WITH PREVIOUS SURVEYS. DISTANCE EAST AND WEST AGREE WITH SURVEYS OF RECORD, EXCEPT CONSUMERS POWER USED IRON 8.28 FEET TO WEST AS CORNER OF TOWNSHIP
ACCEPTED EASTERLY FOUND CORNER AS BEST AVAILABLE EVIDENCE OF CORRECT CORNER POSITION
CORNER APPROVED BY PEER REVIEW MEETING HELD DECEMBER 21, 1994.
SEE DOSSIER FOR ADDITIONAL INFORMATION.

	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1	
3												
4	7		6		5		4		3		2	
5												
6	16		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

APPROVED BY
PEER REVIEW
12-21-94 TL
DATE P.A. 345 of 1990

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-1: SET 5/8"x36" REROD WITH 3-1/4" AL. OGEMAW REMON CAP IN MON BOX
N38W 58.14' SET NAIL IN POWER POLE
N67E 70.99' SET NAIL IN 8" ELM
S27E 38.27' SET NAIL IN 6" POST
S43W 48.10' SET NAIL IN 8" POST
WEST 8.28' FD 1/2" IRON BAR USED AS CORNER BY CPCo

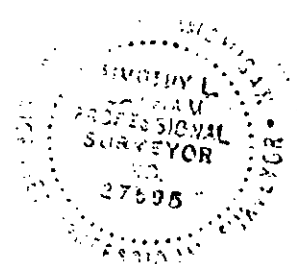

Signed by [Signature] Date 12/28/94
Surveyor's Michigan License No. 27595