

SURVEY & REMONUMENTATION

MAY 03 1995

LAND CORNER RECORDATION CERTIFICATE

COMMISSION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

OGEMAW

(County)

Located in:

Corner Code ##

- | | | |
|---------------------------------------|--------------------------|-------|
| 1. Public Land Survey | T <u>23N</u> R <u>3E</u> | K-1 |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling
in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous
Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

LIBER

2 PAGE 260

STATE OF MICHIGAN
OGEMAW COUNTY
RECORDED

3 JAN 95 9:35 A.M.

WANDA MUZIK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Timothy L. Lapham, in a field survey on December, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-1: GLO CLASON 1846, SET POST

W. PINE 20" S30W 35LKS

W. PINE 18' S30E 34LKS

1945 SHADKO (DNR) SURVEY, FOUND 1" PIPE AND PLACED MONUMENT, 3 WITNESSES (PRESUMED TO BE COMMON CORNER TO 4 SECTIONS)

CALDWELL SURVEY 3-253 APRIL 1980, NO CORNER MAT, NO WITS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-1: NO EVIDENCE FOUND OF ORIGINAL OR SUBSEQUENT CORNER, EXCEPT SHADKO CORNER FOUND AND DETERMINED TO BE STANDARD CORNER NOT CLOSING CORNER

SET CORNER AT GLO DISTANCE OF 11.88' EAST OF FOUND CORNER K13 T24N R3E

ACCEPTED ESTABLISHED CORNER AS BEST AVAILABLE EVIDENCE OF THE CORRECT POSITION OF THE ORIGINAL CORNER

CORNER APPROVED AT PEER REVIEW MEETING HELD DECEMBER 21, 1994

SEE DOSSIER FOR ADDITIONAL INFORMATION

APPROVED BY
PEER REVIEW

12-21-94 TL

DATE P.A. 345 of 1990

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-1: SET 5/8"x36" HEROD WITH 3-1/4" ALUMINUM OGEMAW REMON CAP IN MON BOX


N09E 132.71' NAIL IN 20" OAK

S27E 44.02' NAIL IN POWER POLE

S53W 60.61' NAIL IN CEDAR POST

WEST 11.89' REMON MONUMENT, K-13 T24N R3E

N47W 58.42' CEDAR SIGN POST

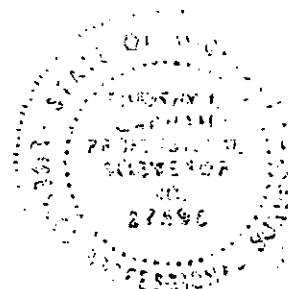

Signed by _____

Date 12/29/94

Surveyor's Michigan License No. 27595