

**SURVEY & REMONUMENTATION**

APR 28 1996

COMMISSION

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
**Ogemaw**

Located In:

Corner Code #

1. Public Land Survey	T	24N	R	2E	G-13
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T	R	
	S		T	R	
3. Miscellaneous Property in Sec.	S		T	R	
	S		T	R	

LIBER **n 3** PAGE **43**

STATE OF MICHIGAN  
 OGEMAW COUNTY  
 RECORDED

28 DEC 95 3:24 P.M.

WANDA MUZIK  
 REGISTER OF DEEDS  
 Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	15		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Timothy L. Lapham, in a field survey on December, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

G-13: GLO Clason 1838 Set Post, 24" W. Pine N25E 40 lns, 12" W. Pine N61W 31 lns;  
 GLO Mullett 1846 Found Post, 2 new Wits: 20" W. Pine S40E 23 lns, 14" Y. Pine S39W 1.24 ch;  
 LCRC Cavanagh 9/26/73 (Rec 1-48) no corner material 3 witnesses;  
 LCRC DeLamater 11/9/87 (Rec 1-358, 11/16/87), Found Rebar and Cap #21670, 3 Wits;  
 LCRC Lapham 11/2/89 (Rec 2-41), Found Capped Iron, 4 Wits;


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

G-13: No evidence of GLO survey found. Found 1/2" rerod in accord with all record LCRC's. Accepted found corner as best evidence of accepted corner position. See dossier for additional information.

APPROVED BY  
 PEER REVIEW  
 12/11/95 *JL*  
 DATE P.A. 345 of 1990

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

G-13: Set 5/8" X36" rerod with 3-1/4" Aluminum Ogemaw Remon cap marked "27595 1995"  
 From Which:  
 N33E 21.50' 12" Oak w/spike  
 S33E 38.63' 8" Oak w/spike  
 S34W 24.11' 6" X8" Guard Rail Post  
 N43W 27.95' 10" Twin Oak w/spike

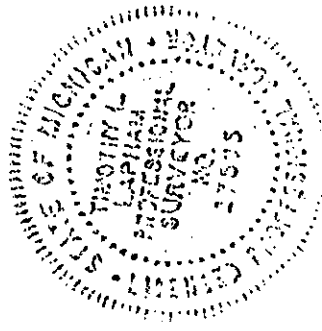

Signed by *Timothy L. Lapham*

Date 12/28/95

Surveyor's Michigan License No. 27595