

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Ontonagon  
 (County)

Located In:

Corner Code #

- |                                    |                         |       |
|------------------------------------|-------------------------|-------|
| 1. Public Land Survey              | T 52N R 37W             | L7    |
|                                    | T 52N R 37W             | M11   |
|                                    | T _____ R _____         | _____ |
|                                    | T _____ R _____         | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
|                                    | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec.  | S _____ T _____ R _____ | _____ |
|                                    | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

May 30 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5			4		3			2	1
3													
4	7			8			9		10			11	12
5													
6	18			17			16		15			14	13
7													
8	19			20			21		22			23	24
9													
10	30			29			28		27			26	25
11													
12	31			32			33		34			35	36
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

(L7) Quarter corner common to Section 13 & 24. 1846: Established by S.W. Higgins. ...40.02 Set 1/4 Sect. post. Sugar 8 N54E 21, Ironwood 10 S60W 25. 1964: Billy D. Buckler, RLS found wood post and rough measured east to Section corner 34.35 chains.  
 (M11) Corner common to Sections 25-36 T52N-R37W and 30-31 T52N-R36W. 1845: Established by Wm.A. Burt. Set post corner of Secs. 25 & 36. Sugar 12 S51W 34, Sugar 10 N47W 52.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**


(L7) Original post and accessories were not recovered. Found a 1-1/4" ID iron pipe, projecting 1.5 feet on an E-W blue paint line and faced by overgrown blazes on four nearby sugars. Found Vulcan location poster on nearby Y.Birch. Measured 34.26 chains east to monumented and recorded Section corner. Accepted the pipe as the best available evidence of the position of the original corner.  
 (M11) Original post and accessories were not recovered. Found a 1-1/4" ID iron pipe projecting about 1 foot. Distances 2669.2' north and 2625.1' south to found iron pipes compare approximately with the original record. Distance west 5306.4' to found iron pipe matches fairly well with original record 79.9 chains (considering that the subdivision was done by S.W. Higgins). Accepted the pipe as the best available evidence of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(L7) Found 1-1/4" ID iron pipe. Blazed and scribed:	(M11) Found 1-1/4" ID iron pipe. Blazed and scribed:
11" Sugar N10E 3.4'      "1/4S NBT"	9" Sugar N58E 26.7'      "S30 NBT"
12" Sugar S20E 6.0'      do	14" Y.Birch S57E 10.0'      "S31 NBT"
5" Y.Birch S76W 16.5'      do	15" Y.Birch South 8.5'      "S36 NBT"
18" Sugar N41W 19.5'      do	4" Sugar N44W 14.1'      "S25 NBT"

All above sugars were found with old blazes. Bearings are magnetic. Distances to notch in lower blaze. Sq'd sugar post adjacent.

Set Squared cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

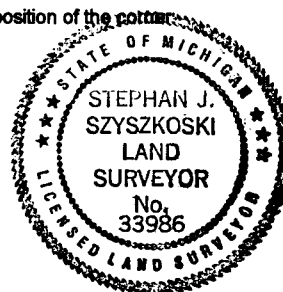

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 9/25/01

For the Michigan Department of Natural Resources - Office of Property Management