

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 17 N. R. 9 W.	J-3; K-3
2. PROPERTY CONTROLLING IN SECTION _____	2, T. 17 N. R. 9 W.	2; 16
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Kenneth J. Ostling, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 29, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~--- Description of original monument, unless otherwise indicated, subject to restoration ---~~

C. (continued)

16

Set 5/8x40" rod w/RLS cap & cedar post	
5" Twn. W. Pine	N15°W 15.3
12" R. Pine	Due E 46.2
Old Fence corner S & W	Due W 5'
N-S Trail	Due E 19'

J-3 B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:  
Found iron in tile monument at corner as previously established, likely by Temple in a local survey. Falls in old E-W fence line.

K-3 Found tile monument at corner, previously used in other local surveys.

2 Set by standard survey procedure for the subdivision of sections.


16 Set corner by standard survey procedure for the subdivision of sections.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-3	K-3	2
Set DNR mon. & cedar post at found iron in tile mon.	Set DNR mon. & cedar post at found iron in tile mon.	Set 5/8" bar w/RLS cap and cedar post w/loc. tag
4" R. Oak N55°W 38.2	6" Maple N02°W 22.0	11" Cherry N15°E 39.1
5" R. Oak N20°E 26.3	10" W. Oak N25°E 28.7	20" R. Oak N60°E 70.6
7" Maple S53°W 35.9	4" R. Oak S25°E 19.5	E-W random Due N 2.6
	€ US-10 Due S 164	E 1/16 on S line Sec. 35 Due W 22.6

SIGNED BY Kenneth J. Ostling  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 10068

DATE 12

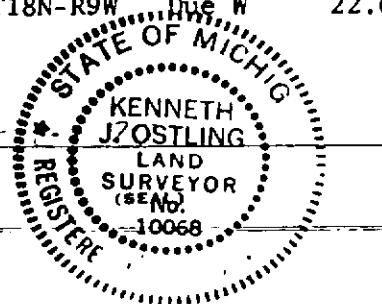

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_  
 HERSEY TOWNSHIP  
 OSCEOLA COUNTY

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET