

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>18</u> N. <input checked="" type="radio"/> R. <u>9</u> W. <input checked="" type="radio"/>	<u>H-13; I-13</u>
2. PROPERTY CONTROLLING IN SECTION <u>34</u>	, T. <u>18</u> N. <input checked="" type="radio"/> R. <u>9</u> W. <input checked="" type="radio"/>	<u>2; 16</u>
3. MISCELLANEOUS PROPERTY IN SECTION_____	, T. _____ N. <input type="radio"/> S. <input type="radio"/> R. _____ E. <input type="radio"/> W. <input type="radio"/>	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Kenneth J. Ostling, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 16, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

C. (continued)

16
Set 5/8 rod w/RLS cap & cedar post w/loc. tag
12" Maple N40°W 38.4
4" Cherry N65°E 34.6
E-W random Due N 9.4
E 1/16 on N line Sec. 3 T17N-R9W
Due E 31.9

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 13 Fd. tile mon. beside remains of pine stump that probably was US corner tree. Probably part of Temple restoration of S township boundary.
- 13 Fd. tile mon. at what we conclude to be the standard corner for Sections 34 and 35. Remains of a Temple BT S55°E 14½'.
- 2 Set by standard survey procedure for subdivision of sections.
- 16 Set corner by standard survey procedure, midpoint on line between section and ¼ corner, for the subdivision of sections.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-13	I-13	2
Set DNR mon. at tile mon. & cedar post	Set DNR mon. at tile mon. & cedar post	Set 5/8"x40" rod w/RLS cap
8" W. Oak N05°E 62.5	7" R. Oak N05°W 35.5	7" W. Oak N55°W 44.8
9" W. Oak N60°E 58.7	11" W. Birch S80°W 18.6	25" W. Oak S70°W 64.1
E-W random Due N 1.7	E-W random Due N 17	Fn. Corner (S & W) S05°E 37
N¼ Sec. 3 T17N-R9W Due E 24.0	NE Sec. 3 T17N-R9W Due E 44.4	Center E-W road Due N 5'
		Set cedar post w/loc. tag 33'


SIGNED BY Kenneth J. Ostling DATE 10/17/77

SURVEYOR'S MICHIGAN REGISTRATION NO. 10068

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

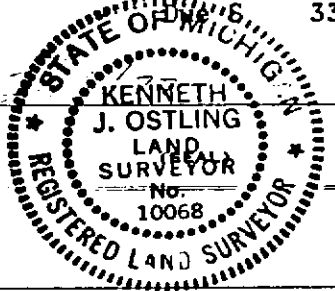

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

CEDAR TOWNSHIP
OSCEOLA COUNTY