

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 18 N. R. 9 W.	K-7; L-7; M-7
2. PROPERTY CONTROLLING IN SECTION 24 _____	T. 18 N. R. 9 W.	1
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Kenneth J. Ostling, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 11, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument as recorded and as subject to restoration~~

C. (continued)

1
Set 5/8"x40" rod w/RLS cap
6" R. Oak N30°W 46.8
14" Twn.R.Oak S40°W 24.7
E-W random Due N 1.4
Fence Corner (E-W & S)
Due S 27

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-7 Found 2" pipe at corner in N-S fence line, about midway between R/W fences going east.
- L-7 Set corner by proportionate measure for departure and 33' north of E-W fence line. This checks location of E 1/16 corner & is faced by old NBT but could not locate previous corner.
- M-7 Fd. iron & tile mon. as previously established, probably by Temple in a survey of the townline. Falls in N-S fence line about 35' south of fence line east.
- 1 Set by standard survey procedure for the subdivision of sections. Previously set by McClung or Temple but could not find previous monument.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-7	L-7	M-7
Set DNR mon. at 2"x30" pipe and cedar post	Set DNR mon. & cedar post	Found 1/2" iron in tile mon. added
5" W. Oak N70°W 10.6	14" Maple S10°E 36.5	DNR monument & cedar post
11" W. Oak N10°W 26.5	8" R. Oak S75°W 37.3	4" R. Oak N30°W 31.8
6" R. Oak S35°E 3.8	Old E-W fence Due S 33	5" R. Oak N50°E 18.0
	*48" W.Pine stp. S80°E 19.8	7" R. Oak S10°E 34.4
	*old NBT w/3 notches	

SIGNED BY Kenneth J. Ostling

DATE 12/7/77

SURVEYOR'S MICHIGAN REGISTRATION NO. 10068

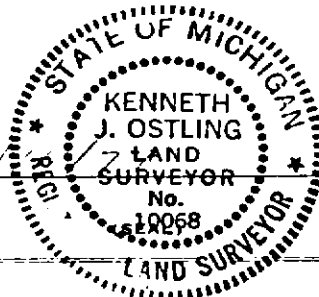

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

CEDAR TOWNSHIP
OSCEOLA COUNTY