

**SURVEY &  
REMONUMENTATION**

JUN 09 1997

COMMISSION

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Osceola</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>19N</u> R <u>10W</u>	<u>G-6</u>
	T <u>  </u> R <u>  </u>	<u>  </u>
	T <u>  </u> R <u>  </u>	<u>  </u>
	T <u>  </u> R <u>  </u>	<u>  </u>
2. Property Controlling in Section	S <u>  </u> T <u>  </u> R <u>  </u>	<u>  </u>
	S <u>  </u> T <u>  </u> R <u>  </u>	<u>  </u>
3. Miscellaneous Property in Sec.	S <u>  </u> T <u>  </u> R <u>  </u>	<u>  </u>
	S <u>  </u> T <u>  </u> R <u>  </u>	<u>  </u>

APPROVED LAND CORNER  
P.A. 545 OF 1990  
Osceola County

*Matthew McClung*  
*24 April 1997*

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Matthew McClung, in a field survey on Apr 18, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16	●	15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

The original corner was set by deputy surveyor Sylvester Sibley on 7 July 1838. Set wood post 40.00 chains from the South.

- Cedar 10" N78E 18 lks.
- Cedar 6" S78W 10 lks.

From 1891 to 1904 approximately, Osceola County had a remonumentation program, in which surveyors Temple and Trumbull, did the work. For the most part, a 3" glazed tile filled with cinders from a forge, were placed at each government set corner in the township. There were supposed to be 3 tile per corner, placed atop of each other, (continued on back)


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 3/4" pipe, 21" long, 3" below road surface. Excavated to 21' removed pipe and located metal below with magnetic locator. Excavated to 24' and found 1/2" smooth rod, .09' West and .04' North of location of 3/4" pipe. Excavated to 31" and found 3" X 3" wood stake and stone 6" square adjacent to rod. Corner is in road intersection and I estimate that original corner appears to be 6 feet below road surface. Place Osceola County Monument in intersection of road 3" below surface.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner G-6. Osceola County Monument, which is a 3" brass cap mounted on a 1" pipe 18" in length.

- 9" Cedar W/M.D.S.H. tag N25E 72.84 feet.
- S. End Hems Wall S52W 27.5 feet.
- 4X4 Sign Post N50W 43.60 feet.
- Telephone Pedestal N55E 48.10 feet.

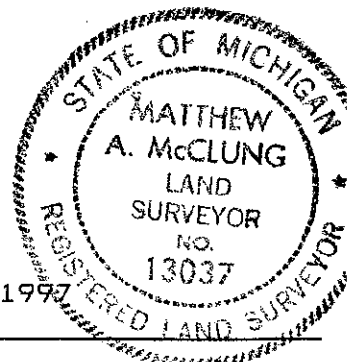

Signed by *Matthew McClung* 13037  
Surveyor's Michigan License No. \_\_\_\_\_

Date April 18, 1997

thereby making the corner 4 feet long. Sometimes a solid tile, with a cross in the top was used, and sometimes a 1/2" iron bars were added to the tile. Notes of the work were kept in ledgers, and given to the townships, and 5 of the townships have been entered in the County Surveyors records.

Act 132:

Liber 433, page 59

Dated: 24 Sept 1985

FD 1 1/4" pipe

N40W Corner fence post 47.08'

N34E 14" Cedar 72.85'

S15E Stop Sign 94.0'

N center line of Rd. 0.50'

LaRoy Township Book:

Page 3

Iron Culvert SW 26.2'

Telephone Pole SW 40.4'

OSCEOLA COUNTY  
REGISTER OF DEEDS  
97 APR 30 PM 12:32

*Wm. W. Crawford*

31

SURVEY &  
REMONUMENTATION

JUN 09 1997

COMMISSION