

FEB 4 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in Osceola Located in: Corner Code#

1. Public Land Survey T 20 N R 10 W A-7
 T R
 T R
 T R

2. Property Controlling in Section S T R
 S T R

3. Miscellaneous Property in Sec. S T R
 S T R

4. Lot No. Recorded Plat

5. Private Claims

OSCEOLA COUNTY REGISTER OF DEEDS
 99 DEC 23 PM 4: 22
 Register of Deeds Stamp & File Number

I, Robert L. Wetherell, in a field survey on November 18, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A-7 - Section corner common to Sections 18 & 19, T20N, R10W, Osceola Co., Mi.

A. Description of original monument and accessories and/or subsequent restoration:

1838 - S. Sibley - G.L.O. 10" Sugar for corner

1919 - G. Johnson, Lake Co. Sur. Railroad Rail #3 - Post N.W. 39' #4 - Pole N.E. 40' #5 - Post S.W. 44'

1972 - J. Erickson, LS 16929 L.C.R.C. - Liber 01, Pg. 127 (Osceola Co.) Railroad rail #7 - 4" W. Cherry S40°E 76.90' #8 - 6" W. Cherry S35°W 55.00' #9 - 6" W. Cherry N85°W 70.96'

1909 - Twp. Book (Burdell) #1 - Distance East - 2494.80' #2 - Distance South - 2693.46'

Undated Lake Co. Survey Records Railroad "T" Rail #6 - 12" W. Pine N11°W 181'

1974 - J. Wilcox, LS 14102 Survey recorded Liber 317, Pg. 490. Same witnesses as Erickson's from 1972

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found narrow gauge railroad rail. Corner is in the centerline of roads (extended) East and South and in line with old fence line to the West (down).

Condition of the accessories are as follows: #1 - Measured 2519.2', #2 Measured 2716.6', #3 Gone, #4 Gone, #5 Gone, #6 Gone, #7 Gone, #8 Found in good condition #9 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


I placed a 1-1/2" Pipe with Osceola County Remon Cap directly over the railroad rail, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 6" W. Pine S36°W 54.10' (60d spike in N.W. side)
- 8" W. Pine N75°W 66.14' (60d spike in S. side)
- Power Pole N25°E 97.29' (P.K. Nail in W. side)
- 6" W. Pine S33°E 71.18' (60d spike in N.E. side)

Signed by Robert L. Wetherell

Date 12/16/99

Surveyor's Michigan License No. 24624

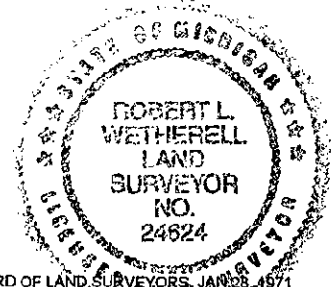

APPROVED LAND CORNER P.A. 345 OF 1990 Osceola County

12/19/99
R.L.W.

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 28, 1971 REVISED MAY 1975 REVISED JAN, 1983 ADAPTED FOR WORD PROCESSING JANUARY, 1999