

**SURVEY &  
REMONUMENTATION**

SEP 15 1994

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Osceola

(County)

Located In:

Corner Code #

- |                                       |                           |            |
|---------------------------------------|---------------------------|------------|
| 1. Public Land Survey                 | T <u>20N</u> R <u>10W</u> | <u>D-7</u> |
|                                       | T _____ R _____           | _____      |
|                                       | T _____ R _____           | _____      |
|                                       | T _____ R _____           | _____      |
| 2. Property Controlling<br>in Section | S _____ T _____ R _____   | _____      |
|                                       | S _____ T _____ R _____   | _____      |
| 3. Miscellaneous<br>Property in Sec.  | S _____ T _____ R _____   | _____      |
|                                       | S _____ T _____ R _____   | _____      |

**APPROVED LAND CORNER  
P.A. 345 OF 1990  
Osceola County**

*Matthew McClung*  
21 June 1994

**Register of Deeds Stamp & File Number**

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Matthew McClung a field survey on June 8, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

The original corner was set by deputy surveyor Sylvester Sibley on 7 July 1838. Set wood post 39.93 chains from East.


Beech 10" S14E 38 lks.

Sugar 7" S75W 21 lks.

This corner is recorded in the Burdell Twp. Book, pages 42 & 43, as pipe. The witness to NE corner. of house does not fit as a new house was built

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

Found 1/2" rod 2" below road surface. Excavated to 14" below road surface and found 1 1/2" pipe, into which the rod was driven. Set Osceola County Monument, leaning to west over center of found pipe. Removed 1/2" rod. Corner is 6" below road surface and is 3' South of road centerline.

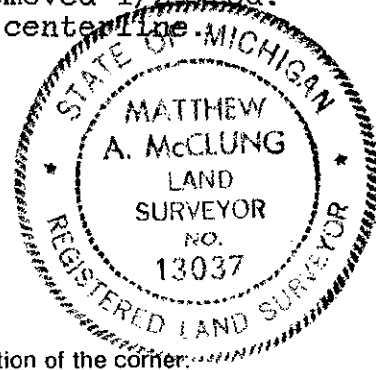

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Corner D-7. Osceola County Monument, which is a 3" brass cap monument, 1" pipe 18" in length.

NE corner of house S15W 84.35 feet.

14" Maple S15W 37.9 feet.

Power pole S05W 33.15 feet.

Power Pole North 63.9 feet.

*Jenny Campbell*  
AUG 19 PM 3:28  
OSCEOLA COUNTY  
REGISTER OF DEEDS

Signed by Matthew McClung Date June 8, 1994  
Surveyor's Michigan License No. 13037