

SURVEY & REMONUMENTATION

SEP 29 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

L 3 Pg 282

STATE OF MICHIGAN
OSCODA COUNTY
FILED

14 SEP 94 11:08 A.M.

PATSY J. PETERS
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

For corners in

Oscoda (County)	Located In:	Corner Code #
1. Public Land Survey	T 26N R 2E	D - 11
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Marvin E. Myers, in a field survey on July 8, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO-July 1839 Coon Mon-Post WIT: 10" Spruce Pine N68°W 4 lks, 8" Spruce Pine N39°E 13 lks,	GLO Oct. 1935 Guy Veal Mon-3 1/2" Brass Tablet in 6" Conc. Mon WIT: 6" J.Pine N28 3/4°W 24 lks. 9" J.Pine S03°W 15 lks.	July 1964 N.Caldwell Mon-Fd. GLO Mon.
---	--	--


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found US GLO 6" Concrete Monument with 3 1/2" Brass Tablet verified position by measurement to accessories of record and is accepted as a careful and faithful reestablishment of the position of the original corner.

APPROVED
County Remonumentation
Peer Review Group
NCC
27 AUG 94

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Mon-US GLO 6" Concrete Monument with 3 1/2" Brass Tablet placed 1/2"x18" steel rebar along North edge for magnetic attraction
WIT: Fd. Spike in East side 10" J.Pine N35°E 27.50'
Fd. Spike in South side 6" J.Pine N66°W 19.66'
Fd. Spike in North side 7" J.Pine S52°E 28.84'
Set 4" Polebarn Nail SW side 4" J.Pine Due South 35.95'
USFS location post alongside corner

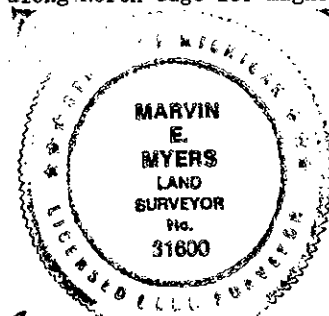

Signed by Marvin E. Myers Date Aug 23, 1994
Surveyor's Michigan License No. 31600