LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in OTSEGO (County)

	Located In:	Corner Code #/#
1. Public Land Survey	T 29N R 3W	A-3,B-3
	T ___ R ___	
	T ___ R ___	
	T ___ R ___	
2. Property Controlling	S 7 T ___ R ___	6,7
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

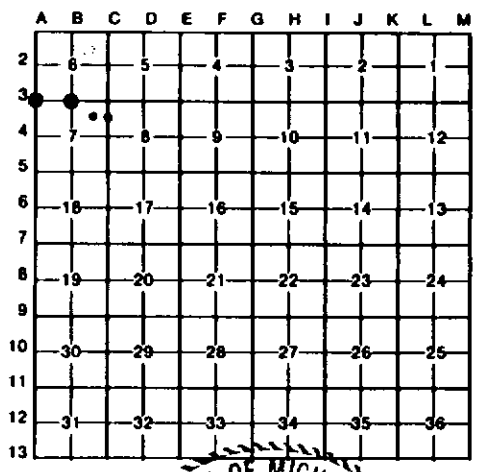

I, CARL KIISKILA, in a field survey on MAY 20, 19 96, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

STATE OF MICHIGAN
CARL KIISKILA
LAND SURVEYOR
No. 33981
LICENSED LAND SURVEYOR

A. Description of original monument and accessories and/or subsequent restoration:

A-3 B-3 6

(NO EVIDENCE OF G.L.O. CORNER, B.T'S, LINE TREES & TOPOGRAPHY, AS CALLED OUT IN THE G.L.O. LINE NOTES; UNLESS NOTED IN ITEM "B" BELOW.)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-3
FOUND AND ACCEPTED A 1/2" IRON ROD IN CONC AS WITNESSED BY J. SCHWANDT PS FOR THE NW COR OF SEC 7. SEE LIBER 319, PAGE 128 FOR HIS CERTIFICATE OF SURVEY. THE MONUMENT IS LOCATED AT A FENCE CORNER WITH A 6' CHAIN LINK FENCE GOING EAST AND A 4' WOVEN WIRE FENCE GOING NORTH.

B-3
FOUND AND ACCEPTED A 1/2" IRON ROD AS WITNESSED BY J. SCHWANDT PS FOR THE N1/4 COR OF SEC 7. SEE LIBER 319, PAGE 128 FOR HIS CERTIFICATE OF SURVEY. A WOVEN WIRE FENCE RUNS WEST AND SOUTH FROM THE MONUMENT.

6
FOUND AND ACCEPTED A 1/2" IRON FOR THE SE COR OF THE NW1/4 OF THE NE1/4 OF SEC 7, AS SET BY OTSEGO CO. SURVEYOR G. DELAMATER, 1924 SURVEY. SEE BOOK 2, PAGE 294. ALSO USED IN SUBSEQUENT SURVEYS BY BERYL JONES PS #23514; SEE LIBER 3, PAGE 6 LCRC FOR MORE INFORMATION.

7
FOUND AND ACCEPTED A R.R. SPIKE DRIVEN OVER A 1/2" BAR AS WITNESSED BY BERYL JONES L.S. IN LIBER 3, PAGE 6 LCRC. THIS POSITION FITS STANDARD BLM INSTRUCTIONS FOR THE SUBDIVISION OF A SECTION.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-3
FOUND 1/2" IRON ROD IN CONC.

#18" MAPLE	N19°E	13.98'
#28" MAPLE	N49°E	17.28'
#18" MAPLE	N46°W	10.97'
16" MAPLE	SOUTH	33.99'

#=WIT BY J. SCHWANDT PS #26466

B-3
FOUND 1/2" IRON ROD IN WOVEN WIRE W & S FENCE COR. SET OTSEGO CO. MON & CARSONITE POST.

#10"&16" TW MAPLE	N40°E	4.53'
##6" MAPLE CLUMP	S60°E	36.02'
##8" MAPLE	S05°W	40.52'
6" MAPLE	S77°W	36.72'

##=WIT BY J.SCHWANDT PS #26466
#= OLD WIT BY OTHERS

6
FOUND 1/2" IRON, SET 1" IRON PIPE OVER IRON AND SET CARSONITE POST.

6" OAK	N70°W	9.84'
6" OAK	N16°E	11.34'
8" OAK	S65°E	22.19'
8" OAK	S05°W	31.70'

7
FOUND R.R. SPIKE.

6" WHITE PINE	S89°E	23.39'
6" WHITE PINE	S50°E	24.57'
P. POLE	N40°W	41.81'
10" WHITE PINE	S87°W	45.13'
CAPD IRON B.JONES	WEST	39.09'
CTR N-S B.TOP RD	WEST	6.0'

Signed by Carl T. Kiiskila Date 2-26-97

Surveyor's Michigan License No. #33981

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983