

SURVEY & REMONUMENTATION

OTSEGO COUNTY REMONUMENTATION

MAY 28 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

ALSO ACT 345, PA 1990

For corners in

<u>Otsego</u> (County)	Located In:	Corner Code #
	OTSEGO LAKE TOWNSHIP	
1. Public Land Survey	T <u>29N</u> R <u>3W</u>	<u>G-4</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

OTSEGO COUNTY MICHIGAN
RECEIVED FOR RECORD
96 DEC 30 PM 2:13
 EVELYN M. PRATT
 CLERK / REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, **James L. Schwandt**, in a field survey on **Oct. 21**, 19**96** do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9	●	10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

G-4 T29N-R3W
 G.L.O. Harvey Mellen
 June 7, 1857
 Set Qrt Sec Post
 W. Birch 14°N75°E, 11 Links (7.26')
 Maple 14° S26°W, 3 Links (1.98')


LCRC (3-23)
 C. Robinson, 1989
 Fnd 1/2" Iron Midway & on Line between G-3 & G-5
 Set OCM over 1/2" Iron
 5" Twn Maple N23°E, 20.55'
 6" Maple S14°W, 11.68'
 5" Maple N24°W, 10.18'
 6" Maple N11°W, 24.32'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found OCM
 Found 10" Twin Maple N23°E, 20.55'
 Found 10" Maple S14°W, 11.68'
 Found 10" Maple N24°W, 10.18'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

OCM 30' ± South of Gas Pipeline, and is accepted as a careful & faithful reestablishment of the position of the original corner.
 Found Nail in 10" Twin Maple N23°E, 20.55'
 Found Nail in 10" Maple S14°W, 11.68'
 Found Nail in 10" Maple N24°W, 10.18'
 Set Nail in 10" Maple S8°E, 31.35'

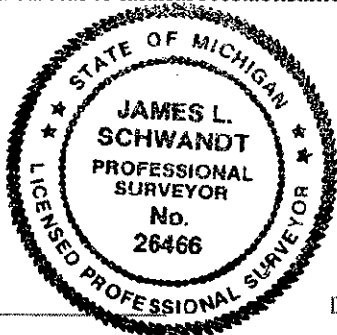

OTSEGO COUNTY REMONUMENTATION

Approved by the County Survey Peer Group, pursuant to Act 345, PA 1990.
 Nov. 1, 1996 *[Signature]*
 Date Chairman

Signed by *James L. Schwandt*
 Surveyor's Michigan License No. 26466

Date 11-1-96