

REMONUMENTATION

APR 25 1995

**COMMISSION**  
For corners in

OTSEGO COUNTY REMONUMENTATION  
**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970  
ALSO ACT 345, PA 1990

LIBER 0004 PAGE 24

OTSEGO (County)	Located in:	Corner Code ##
1. Public Land Survey	T 29N R 3W	G-5
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

OTSEGO COUNTY  
MICHIGAN  
RECEIVED FOR RECORD

94 DEC 14 PM 4:03

LYLLYN M. PRATT  
CLERK / REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, James L. Schwandt, in a field survey on November 16, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5				16	15	14	13						
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. Harvey Mellen, 1857  
Set Post Corner of Sections  
9, 10, 15 and 16  
14" W. Pine S57½°W 26 Lks.  
20" W. Pine S3°E 25 Lks.

G.F. Delamater, 1931  
Fd. one Gov't B and Post  
Set ½" x 30" bar in corner  
6" B. Oak N13°E 45.6'  
24" W.P.S. S38°W 48.2'

Eugene Ostling  
August 6, 1972  
Fd. ¾" pipe unknown  
Origin LCRC, L1, P 95;  
14" Poplar N28°W 55.1'  
14" R. Oak N11°E 45.3'  
10" Poplar N40°E 68.8'

Carl Robinson  
August 16, 1972  
Fd. ¾" iron pipe - fits GLO to South 1/4 corner & SW corner  
LCRC, L 1, P 89; P.P. (Spk in NE side) N75°W 99.89';  
15" B. Oak (Spk in West side) N8°E 45.79'; 15" Maple (Spk in NW side) S50°W 132.36'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found ¾" iron pipe fitting witnesses from C.I. Robinson 8-16-72 and referenced to L.C.R.C., Liber 1, Page 89. Oak witness is common through Ostling and was set by Delamater 1931. Delamater's position was based on found Government B & P.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-5 Found ¾" iron pipe removed and replaced with O.C.M. O.C.M. is accepted as a careful and faithful perpetuation of the position of the original corner.

14" Black Oak N17°E 45.79' Found Nail  
4" Aspen S45°E 49.00' Set Nail/Tag  
P.P. N67°W 99.89' Found Spike  
3" Oak N35°W 72.56' Set Nail/Tag

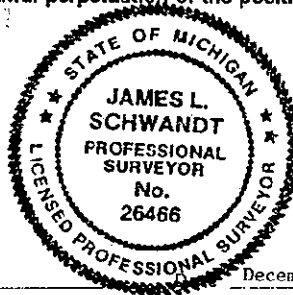

OTSEGO COUNTY REMONUMENTATION

Approved by the County Survey Peer Group, pursuant to Act 345, PA 1990.

Dec 13, 1994 [Signature] Chairman

Signed by James L. Schwandt  
James L. Schwandt, PS 26466  
Surveyor's Michigan License No. \_\_\_\_\_

December 7, 1994