

REMONUMENTATION

APR 25 1995

COMMISSION

For corners in

OTSEGO COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 0004 PAGE 30

ALSO ACT 345, PA 1990

OTSEGO (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>29N</u> R <u>3W</u>	J-3
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

OTSEGO COUNTY
 MICHIGAN
 RECEIVED FOR RECORD
 94 DEC 14 PM 4:04
 EVELYN M. PRATT
 CLERK / REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, James L. Schwandt, in a field survey on November 11, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	I
2	6	5	4	3	2	1							
3									⊕				
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. Harvey Mellen, 1857
 Set 1/4 corner
 30" Hemlock N31°W 11 Lks.
 9" Hemlock S22°E 16 Lks.

Stanley O. Thorson #5788
 March 17, 1953
 5" Maple S10°E 59.6'
 4" Maple S69°W 48.4'
 Placed T-iron M.P.O.L.

C. Eugene Ostling
 June 9, 1972
 Fd. T-iron
 8" Maple N70°W 39.7'
 8" Maple S70°20'E 48.75'
 5" R. Pine S07°45'W 14.95'

Carl I. Robinson
 May 12, 1981
 Set O.C.M.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found O.C.M. set by C.I. Robinson 5-12-81 that fits with C.E. Ostling's 8" Maple NW and 5" R. Pine. Ostling's third witness, which was later obliterated, would have been S.O. Thorson's 4" Maple, perpetuating this corner from 3-17-53. No link to G.L.O.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-3 Found O.C.M. is accepted as a careful and faithful re-establishment of the position of the original corner.

10" R. Pine N47°E 18.55' Set Nail/Tag
 14" Maple S02°E 48.70' Found Nail
 12" Maple N70°W 39.60' Found Nail
 14" R. Pine N02°W 14.85' Found Nail

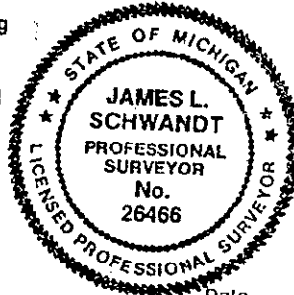

OTSEGO COUNTY REMONUMENTATION

Approved by the County Survey Peer Group, pursuant to Act 345, PA 1990.

Dec. 13, 1994 *[Signature]*
 Date Chairman

Signed by *[Signature]*
 James L. Schwandt, PS
 Surveyor's Michigan License No. 26466

Date December 7, 1994