

SURVEY & REMONUMENTATION

MAY 28 1997

COMMISSION

OTSEGO COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

ALSO Act 345, PA 1990

OTSEGO COUNTY MICHIGAN RECEIVED FOR RECORD

96 DEC 30 PM 2:17

EVELYN M. PRATT CLERK / REGISTER OF DEEDS

For corners in

Table with columns: OTSEGO (County), Located In: Elmira Twp., Corner Code #, and survey details for Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Carl I. Robinson, in a field survey on November 25, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Grid table with columns A-L and rows 1-13, containing numbers 1-36.

A. Description of original monument and accessories and/or subsequent restoration:

- GLO 2/386: John Hodgson, 1839: Set 1/4 Section Post-Sugar 14" N62°E 19 lks (12.5'), Birch 19" N 82°W 12 lks (7.9').
CSR 2/194: G.F. DeLaMater, 1919: Established Iron at Corner .50 ch. N of Road G (wire fence within 2' of compass)- Sugar 10" N 24°25' E 70 1/2 lks (46.5'), Elm 4" N 82°W 70 1/2 lks 46.5'.
LCRC 1/183: W.W. Wakenhut, 1973: Found 1/2" Iron Rod with 1" Pipe beside it 2 1/2 to 3' below road & Concrete Monument North, Placed 1/2"x24" Iron over it in Monument Box-Concrete Monument North 34.01', 9" Quad.Maple North 87.28', 4"-6" Quad.Maple N 35°E 80.60'.
LCRC 3/117: D.E. Sagasser, 1994: Found 1/2" ReRod w/Cap in Monument Box & all Wakenhut's references, replaced 1/2" ReRod w/RLS#14770 cap in Monument Box after new construction-Concrete Monument North 34.01', 2-10" Quad Maples N 35°E 80.60', P.Pole S 13°W 32.21', P.Pole N 08°W 32.64', Also Construction Witnesses Tacked Hub N 13°13'13" E 36.28' & PK in P.Pole for Azimuth S 13°13'13" W 31.7'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" Capped Iron Rod in Monument Box, Wakenhut's Maples N & NE, and Chenard's P.Poles NW & SW.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1/2" Capped Iron Rod in Monument Box .1± N. of pavement centerline, accepted as a careful and faithful reestablishment of the position of the original corner-(new) spk Tri 12" Maple (1 trunk cut off) N 3°E 87.50', spk Tw. 9" & 12" Maple (2 trunks cut off) N 32°E 80.60', spk under tag P.Pole S 13°W 32.21', spk under tag P.Pole N 11°W 32.64'.

OTSEGO COUNTY REMONUMENTATION

Approved by the County Survey Peer Group, pursuant to Act 345, PA 1990.

11/26/96 Date V. Chairman

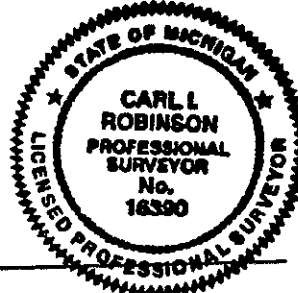

Signed by Carl I. Robinson, PE & PS, Otsego County Surveyor
Surveyor's Michigan License No. 16390

Date November 25, 1996