

**OTSEGO COUNTY REMONUMENTATION**  
**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970  
 ALSO Act 345, PA 1990

**LIBER 0004 PAGE 54**

For corners in

<u>OTSEGO</u> (County)	Located in:	Corner Code #:
1. Public Land Survey	T 21 N. R 7 W	H-11
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

OTSEGO COUNTY  
 MICHIGAN  
 RECEIVED FOR RECORD  
 94 DEC 29 PM 1:33  
 LVELIN H. PRATT  
 CLERK / REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

A	B	C	D	E	F	G	H	I	J	K	L
2	3	4	5	6	7	8	9	10	11	12	13
3	4	5	6	7	8	9	10	11	12	13	14
4	5	6	7	8	9	10	11	12	13	14	15
5	6	7	8	9	10	11	12	13	14	15	16
6	7	8	9	10	11	12	13	14	15	16	17
7	8	9	10	11	12	13	14	15	16	17	18
8	9	10	11	12	13	14	15	16	17	18	19
9	10	11	12	13	14	15	16	17	18	19	20
10	11	12	13	14	15	16	17	18	19	20	21
11	12	13	14	15	16	17	18	19	20	21	22
12	13	14	15	16	17	18	19	20	21	22	23
13	14	15	16	17	18	19	20	21	22	23	24

I, Carl I. Robinson, in a field survey on December 20, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**


- GLO 2/154: A. Burt, 1850: Set Post-Cedar 12" S 33°E 38 lks (25.1'), Y. Birch 6" N 26°W 30 lks (19.8').
- CSR 2/404: G.F. DeLaMater, 1929: Cedar Post, found both Gov't B's, Cedar stump 36" N 10°E 67.3' Cedar stump 24" S 41°W 31.0'.
- Misc.-U.C.R.C., 1966: Set Monument Box from one witness and fence line north-36" Cedar stump (NB1) N 11°E 68.60', 12" Poplar S 20°E 59.87', 12" Poplar S 22°W 49.55'.
- LCRC 2/306: Glen F. DeLaMater, 1983: Monument Box-10" Cedar S 16°W 52.58', P. Pole N 10°W 32.9', 8" Cedar N 25°E 51.8'.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

Found Square Head Bolt in Monument Box in centerline of pavement on fence north & south, 36" Cedar stump N 10°E 68.31, 10" Cedar stump N 25°E 51.8'. Pipeline construction destroyed all witnesses south of R/W fence.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Square head Bolt in Monument Box in pavement centerline and fence line north & south, and is accepted as a careful and faithful perpetuation of the position of the original corner, nail 7" Cedar N 36°E 66.11', nail 21" Basswood S 38°E 101.46', spk 10" Hemlock S 40°W 65.65', PK P. Pole N 10°W 32.90'.

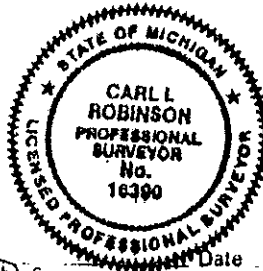

**OTSEGO COUNTY REMONUMENTATION**

Approved by the County Survey Pair Group, pursuant to Act 345, PA 1990.

12/21/94 Date [Signature] V. Chairman

Signed by [Signature]  
 Carl I. Robinson, PE & PS, Otsego County Surveyor  
 Surveyor's Michigan License No. 16390

Date December 21, 1994