

REMONUMENTATION

APR 25 1995

COMMISSION

For corners in

OTSEGO
(County)

OTSEGO COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE LIBER 0004 PAGE 057
Filing Requirement of Act 74, Mich. P.A. 1970
ALSO Act 345, PA 1990

Located In:

Corner Code #

1. Public Land Survey

T 31 N R 2 W

K-11

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec.

S T R

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

OTSEGO COUNTY
MICHIGAN
RECEIVED FOR RECORD
94 DEC 29 PM 1:34
LYLLYN M. PRATT
CLERK / REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Carl I. Robinson, in a field survey on December 21, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.


- A. Description of original monument and accessories and/or subsequent restoration:
- GLD 2/164: A. Burt, 1850: Set Post-Beech 14" N 75°W 20 lks (13.2'), Beech 10" S 58°E 3 lks (2.0').
 - CSR 2/124 & 134: D.M. Hoffman, undated: Found Post, Hemlock 7" S 45°W 44 lks (29.0'), Sugar 20" N 36½°E 51 lks (33.7').
 - CSR 2/440: G.F. DeLaMater, 1932: Found Hoffman's B & P set ½"x30" bar- Concrete Monument N 46°W 46.7', Concrete Monument S 46°E 46.7'. (Note: OCRC set Mon. Box per 1966 Construction Plans).
 - LCRC 1/235: L.M. Gerschbacher, 1973: ½" bar in pavement box as found, No accessories available.
 - LCRC 2/77: P.E. Chenard, 1977: ½" bar in Mon. Box 1' north of centerline of road-Fe. Post N 40°W 71.38', Corner Fe. Post S 45°E 68.15', Gas Line Vent Marker S 45°W 59.02'.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found ½" Iron Rod in Monument Box 2'± north of pavement centerline and in approximate centerline on roads to north & south, Chenard's fence posts & gas vent (bent).

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

½" Iron Rod in Monument Box 2'± north of pavement centerline and in approximate centerline of roads to north & south, and is accepted as a careful and faithful perpetuation of the position of the original corner-Gas Line Vent N 53°E 71.0', nail Corner Fence Post S 35°E 69.15', Gas Line Vent (bent) S 55°W 59.0', tag Corner Fence Post N 22°W 72.18'.

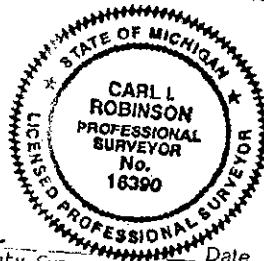

OTSEGO COUNTY REMONUMENTATION

Approved by the County Survey Peer Group, pursuant to Act 345, PA 1990.

12/22/94
Date

V. Chairman

Signed by Carl I. Robinson
Carl I. Robinson, PE & PS, Otsego County Surveyor
Surveyor's Michigan License No. 16390

Date December 21, 1994