

**SURVEY &  
REMONUMENTATION**

APR 05 1996

**Ottawa County Remonumentation  
LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

**COMMISSION**

<u>Ottawa</u> <small>(County)</small>	Located In:	Corner Code #
1. Public Land Survey	T <u>5N</u> R <u>14W</u>	<u>I-13 (SE, 34)</u>
	T _____ R _____	<u>Zeeland Twp.</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

**RECORDED**

95 NOV 29 PM 1:42

*Edythe K. Ballman*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

**Register of Deeds Stamp & File Number**

I, John C. Bueche, in a field survey on November 14, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

I-13 GLO Lucius Lyon, D.S. 1832 W. Oak 20 cor. 34 & 35	LCRC L2-P739, Jan., 1975 3/4" pipe Near W. edge bit. Rd. sign N 20 W 24.05' USGS Mon. W 44.25' TP N 85 E 42.56' Iron E 22.49'	LCRC L3-P297, Spet., 1978 Found 3/4" pipe Set cast iron mon. USGS Mon. W 44.25' RLS tag 18435 in face TP E 42.37' RLS tag 18435 in face 8" Ash SE 82.66' Iron pipe E 22.49'
--	---	---

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I-13 Found broken cast iron mon. 1.5'± below edge bit. rd.  
USGS Mon. W 44.25'  
Iron pipe E 22.49'

And is accepted as a careful and faithful perpetuation of the position of the original corner.

P.A. 345 OTTAWA COUNTY

PEER APPROVED 11/20/95


*Richard P. Redwood*  
R.P.R.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I-13 Replaced broken cast iron mon. with 3/4" x 24" Pin with Ottawa Co. Cap	
Set Nail & Ottawa Co. Remon. Tag in E side PP	N 10 W 181.78'
Set Nail & Ottawa Co. Remon. Tag in N side 8" Ash	N 90 E 65.23'
Set Nail & Ottawa Co. Remon. Tag in NE side 10" Ash	S 45 E 83.08'
Set Nail & Ottawa Co. Remon. Tag in N side PP	N 85 W 45.86'
USGS Mon.	N 90 W 44.25'
Bit. East 0.5'±	
C/L N-S, East 13.0'±	

Signed by John C. Bueche  
John C. Bueche, P.S. 13027  
Surveyor's Michigan License No. \_\_\_\_\_

Date Nov 16, 1995

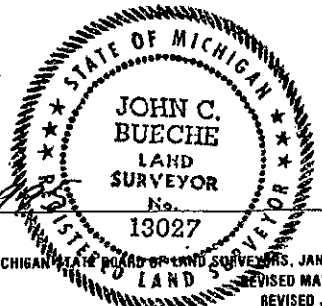

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983