

**Ottawa County Remonumentation
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in
Ottawa
(County)

Located In: Corner Code =#

1. Public Land Survey	T <u>5N</u> R <u>14W</u>	<u>K-10 (E 1/4, 26)</u>
	T _____ R _____	<u>Zeeland Twp.</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

RECORDED

96 DEC 17 AM 10:42

Phyllis Callman
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, John C. Bueche, in a field survey on November 4, 19 96, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

K-10 GLO	Ottawa Co. Surveyors	Ottawa Co. Surveyors Records
Calvin Britain,	Records	Stone, brick, mon. in mon. box
DS, 1832	Forester, 1881	NW 38.0' to 24" Poplar
Set 1/2 mile post	Stone & brick	SW 33.2' to cor. fence
Elm 4 N 3 E 10	14" Linn N 40° E 95.0'	NW 32.5' to NE cor. North hdwl.
Sugar 4 S 22 E 16	20" W Ash S 50° E 59.0'	SW 32.9' to SE cor. South hdwl.
	E 1/4 to SE cor. 29.96'	
	(2637.36')	
	E 1/4 to C 1/4 40.06' (2643.96')	

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-10 Found Ottawa Co. Mon. (2" Harrison Mon.) in Mon. Box on C/L bit. rd. N-S; on field division West
No wit. remaining
Meas. S to SE cor. 2637.27'
Meas. N to NE cor. 2645.17'

And is accepted as a careful and faithful perpetuation of the position of the original corner.

P.A. 345 OTTAWA COUNTY


PEER APPROVED 11-11-96

J.C.B.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-10 Ottawa Co. Mon. (2" Harrison Mon.) in Mon. Box
Nail & Ottawa Co. Remon. Tag in W side PP S 30° E 65.53'
Nail & Ottawa Co. Remon. Tag in W side PP N 05° E 293.55'
X cut on S end CMP S 35° W 50.20'
X cut on N end CMP S 80° W 28.35'
On C/L bit. N-S
On field division West

\$ 9.00 CORNER
\$ 1.00 PHOTO

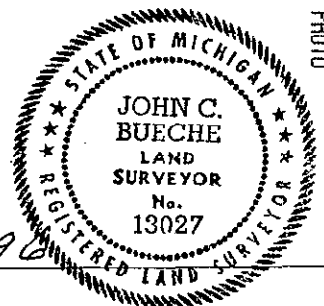

Signed by John C. Bueche
John C. Bueche, P.S. 13027
Surveyor's Michigan License No. _____

Date 11-7-96