

FEB 24 2000

RECORDED

SECTION

OTTAWA COUNTY REMONUMENTATION

99 DEC -2 PM 1:12

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Sam Sublett
REGISTER OF DEEDS
OTTAWA COUNTY MI

For corners in

OTTAWA
(County)

Located In:

Corner Code #

Sec. 2

1. Public Land Survey

T 5N R 14W
T R
T R
T R

M-6, E 1/4 corner
Section 13, Zeeland
Twp

2. Property Controlling in Section

S T R
S T R

3. Miscellaneous Property in Sec.

S T R
S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Randal J. Vugteveen, in a field survey on September 27, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-6 Peer Approved Corner Liber 3, Page 292 (Bueche November 7, 1997), 3/4" X 24" iron bar with remon cap
Nail & Remon Tag S side P. Pole N80°W 154.38'
Nail & Remon Tag N side P. Pole S85°W 151.56'
Nail & Remon Tag SE side P. Pole S40°W 37.92'
Nail & Remon Tag W side P. Pole S35°E 40.96'
Nail & Remon Tag S side (4' up) in group of 6"-10"
Box Elder N40°E 37.74'
On Centerline gravel road West
Centerline of Gravel Road N-S is West 3'+/-

OTTAWA COUNTY
11/15/99
YD7

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-6 on June 13, 1999 recovered bar with remon cap (1' Deep)

(All section A witnesses check okay)


Accepted 3/4" Bar with Remon Cap as a careful and faithful perpetuation of the position of the original corner.
OCRC to rebuild road at this time.
Set iron rebar witnesses outside of construction

September 27, 1999 recovered iron rebar witness and reset 3/4" X 24" Iron Bar with Remon Cap.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-6 3/4" X 24" Iron Bar with Ottawa County Remon Cap

Set Nail & Remon Tag in N side Power Pole S47°W 41.47'
Set Nail & Remon Tag in N side Guy Pole S42°E 44.32'
Found Nail & Remon Tag in N side Power Pole S83°W 151.57'
Found Nail & Remon Tag in S side Guy Pole N78°W 154.37'
Set PK with Remon Tag in East end 72" CMP N18°E 111.34'
On centerline North and South gravel road (to be paved next week)
Centerline gravel road to West, North 3.8'

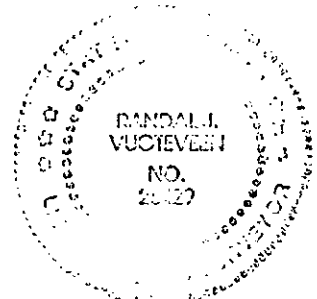

Signed by *Randal J. Vugteveen*
Surveyor's Michigan License No. 28429

Date OCTOBER 27, 1999

\$4.00 CORNER
Receipt #64945