

SURVEY & REMONUMENTATION

DEC 01 1998

**OTTAWA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

RECORDED

98 MAR 16 PM 12:37

[Signature]
REGISTER OF DEEDS
OTTAWA COUNTY, MI

For corners in

OTTAWA

(County)

Located In:

Corner Code #

- | | | | |
|---------------------------------------|--------------|---------------|--|
| 1. Public Land Survey | T <u>5</u> N | R <u>15</u> W | C-4 (E 1/4 cor
Section 7) Holland
Twp. _____ |
| | T _____ | R _____ | |
| | T _____ | R _____ | |
| | T _____ | R _____ | |
| 2. Property Controlling
in Section | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |
| 3. Miscellaneous
Property in Sec. | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Randal J. Vugteveen, in a field survey on August 22, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L
1											
2	6	5	4	3	2	1					
3											
4	7	8	9	10	11	12					
5											
6	18	17	16	15	14	13					
7											
8	19	20	21	22	23	24					
9											
10	30	29	28	27	26	25					
11											
12	31	32	33	34	35	36					
13											

A. Description of original monument and accessories and/or subsequent restoration:

Common corner to Sections 7 & 8
1832 - Brookfield
Set 1/2 mile post
Hemlock is post
No witnesses made

LCRC Liber 6, Page 224
Fnd R.R. Spike
Fnd PK N side P. Pole S60°W 40.22'
Set PK E side 24" Maple N35°W 62.45'
Centerline Top Hyd N30°E 51.22'
Set 16D nail N side 20" poplar S60°E 75.04'

LCRC Liber 1, Page 655
Fnd R.R. Spike
26" D.B.H. Maple SW 42.22'
St. Sign W 23.07'
Tel. Pole W 34.65'
20" D.B.H. Maple NW 48.45'
Hyd NE 51.20'
P. Pole NE 40.27'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-4 Found PK nail in bit 1' West of centerline 136th Ave. & 4.5' S of centerline Greenly St. East

PK N side P. Pole S60°W 40.14'
PK E side 24" Maple N35°W 62.39'
N side 20" Poplar S60°E 75.06'

Accepted position of PK nail as a careful perpetuation of the position of the original corner

Removed PK nail, set 3/4" x 24" solid rod with Ottawa County Remon cap in mon box

P.A. 345 OTTAWA COUNTY
PEER APPROVED 12/1/97

[Signature]


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-4 3/4" x 24" solid rod with Ottawa County Remon Cap in monument box

- Set Ottawa County Remon tag & nail in N side P. Pole AZ 253° 40.14'
- SE block foundation corner house #1206 AZ 293° 79.07'
- Set Ottawa County Remon tag & nail in N. side 20" Poplar AZ 109° 75.11'
- NW corner conc. retaining wall house #216 AZ 141° 117.85'
- Top of Hydrant AZ 39° 51.24'
- Centerline 136th Ave. East 1.0'
- Centerline Greenly St. (to East) North 4.5'

Signed by *[Signature]*
Surveyor's Michigan License No. 28429

Date DEC. 1, 1997

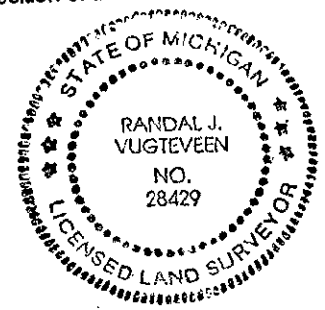

\$ 1.00 PHOTO