

**SURVEY & REMONUMENTATION**

APR 24 1995

**OTTAWA COUNTY REMONUMENTATION**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

94 DEC 14 AM 9:41

COMMISSION  
For corners in  
OTTAWA  
(County)

Located In: Corner Code #

*Phyllis Robinson*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

- |                                    |        |                            |
|------------------------------------|--------|----------------------------|
| 1. Public Land Survey              | 5N 15W | H-9 (S 1/4 cor Section 22) |
|                                    | T R    | Holland Twp.               |
|                                    | T R    |                            |
|                                    | T R    |                            |
| 2. Property Controlling in Section | S T R  |                            |
|                                    | S T R  |                            |
| 3. Miscellaneous Property in Sec.  | S T R  |                            |
|                                    | S T R  |                            |
4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

Register of Deeds Stamp & File Number

I, Randal J. Vugteveen, in a field survey on December 8, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:  
H-9 Common corner to Sections 22 & 27

- |                          |                             |
|--------------------------|-----------------------------|
| 1832 - Brookfield        | Liber 4, Page 322           |
| Set post                 | Concrete monument           |
| B. Ash 10" N71W 7 Links  | 20" Ash NW 25.40'           |
| B. Ash 10" S49E 16 Links | 8" Elm NE 0.80'             |
|                          | 6" Ash South 77.50'         |
|                          | Centerline drain West 10.0' |

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
H-9 Found square conc. mon in roots of SW side 15" Elm & 10' E of N-S drain 2' wide and accepted as a careful and faithful perpetuation of the position of the original corner

- 20" Ash NW 25.40'
- 8" Elm NE 0.80'
- 6" Ash S 77.50'
- Centerline drain W 10.0'

P.A. 345 OTTAWA COUNTY  
PEER APPROVED 12/12/94


*Kudoy P. Nedweld*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-9 Removed concrete mon, set 3/4" X 36" solid bar with Ottawa County Remon Cap

AZ = Michigan State Grid Direction

- Set Ottawa County Remon Tag & Nail in SW side 15" Elm AZ. 355 deg 1.04'
- Set Ottawa County Remon Tag & Nail in SW side 24" Ash AZ. 335 deg 26.05'
- Set Ottawa County Remon Tag & Nail in W side 12" Ash AZ. 160 deg 26.97'
- Set Ottawa County Remon Tag & Nail in W side 12" Ash AZ. 180 deg 77.60'
- Set Ottawa County Remon Tag & Nail in SE side 16" Cottonwood AZ. 210 deg 61.16'

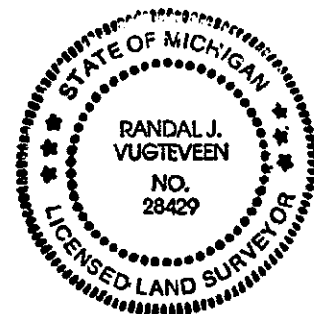

Signed by *Randal J. Vugteveen*  
Surveyor's Michigan License No. 28429

Date Dec 12, 1994