

SURVEY & REMONUMENTATION

DEC 01 1998

Ottawa County Remonumentation 98
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

MAY 22 PM 4:06

SECTION
 For corners in

Ottawa (County)	Located In:	Corner Code #
1. Public Land Survey	T 5N R 16W	M-1 (NE, 1) Park Twp.
	T R	COMMON CORNER
	T 6N R 16W	M-13
2. Property Controlling in Section	S T 5N R 15W	A-1
	S T 6N R 15W	A-13
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Ray Schilt
 REGISTER OF DEEDS
 OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

I, John C. Bueche, in a field survey on March 26, 19 98, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-1 GLO Calvin Britain, 1832 Post 10" Tamarack N 47 W 110 8" Pine N 88 E 93	LCRC Remon. L1, P452 (recorded as M-13, 6-13) Found Ottawa Co. Cast Iron Mon. Ottawa Co. Remon. Tag & Nail in W face PP Az 358° 164.92' C/L hyd. Az 29 34.41' Ottawa Co. Remon. Tag & Nail in W face PP Az 178° 52.03' C/L 144th Ave. Az 90° 86'± Ottawa Co. Remon. Tag & Nail in N face PP Az 105° 121.50'
---	---

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


M-1 Found Ottawa Co. Cast Iron Mon. 1'± below grade
 On C/L bit. E-W; C/L bit. N-S is East 86'±
 As per above wit.

And is accepted as a careful and faithful perpetuation of the position of the original corner.

OTTAWA COUNTY
 PEER APPROVED 4/20/98

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-1 Ottawa Co. Cast Iron Mon. in Mon. Box
 Ottawa Co. Remon. Tag & Nail in W face PP Az 358° 164.92'
 C/L hyd. Az 29 34.41'
 Ottawa Co. Remon. Tag & Nail in W face PP Az 178° 52.03'
 Ottawa Co. Remon. Tag & Nail in N face PP Az 105° 121.50'
 Mon. Box East 86'±
 On C/L bit. E-W; C/L bit. N-S East 86'±

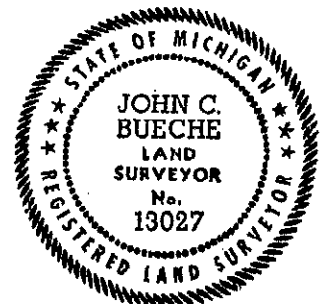

\$ 1.00 PHOTO

Signed by John C. Bueche Date 4-1-98
 John C. Bueche, P.S. 13027
 Surveyor's Michigan License No. _____