

SURVEY & REMONUMENTATION

APR 24 1995

OTTAWA COUNTY REMONUMENTATION

RECORDED

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

94 DEC 14 AM 9:41

Filing Requirement of Act 74, Mich. P.A. 1970

Deborah K. Kallman
REGISTER OF DEEDS
OTTAWA COUNTY, MI

For corners in OTTAWA

(County)

Located In:

Corner Code #

- | | | |
|---------------------------------------|--------------------------|--|
| 1. Public Land Survey | T <u>6N</u> R <u>13W</u> | G-10 (E 1/4 COR of Sec 28) Georgetown Twp. |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 4. Lot No. _____, Recorded Plat _____ | | |
| 5. Private Claims _____ | | |

Register of Deeds Stamp & File Number

I, Randal J. Vugteveen, in a field survey on November 22, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:
G-10 common corner to Sections 27 & 28

1831 - Lyon & Sibley	Liber 2, Page 443	Liber 1, Pages 205 & 206
Set H.M.P.	Fence cor 3' E & s.5' N	Fence cor 3' E & 2.5' N
Cherry 4" S47E 27 Links	12" W Cherry S50½W 58.80'	CP Pole N10½E 22.74'
Pine 30" N31W 22 Links	16" W Cherry S20½W 80.90'	6" Wild Wherry S80½W 35.96'
	6" W Cherry S80½E 10.50'	


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
G-10 Found 3/4" pipe 100' E of 90 deg bend in drainage ditch running S & W and 4.5' SW of cor fence lines N & E and accepted as a careful and faithful perpetuation of the position of the original corner

Fence cor 3' E & 2.5' N	6" Wild Cherry S801/2E 10.50'	Nail in side 6" Wild Cherry ESE 10.50'
CP pole N101/2E 22.7'		Corner fence post (fence N&E) NE 4.5'
6" Wild Cherry S801/2W 36.96'		

P.A. 345 OTTAWA COUNTY
PEER APPROVED 12/12/94
Heather P. Nedwold

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
G-10 Removed 3/4" pipe, set 3/4" X 36" solid bar with Ottawa County Remon Cap

AZ = Michigan State Grid Direction
Set Ottawa County Remon Tag & Nail in N side 10" Wild Cherry AZ. 100 deg 10.53'
Set Ottawa County Remon Tag & Nail in E side 6" Wild Cherry Az. 180 deg 2.53'
Set Ottawa County Remon Tag & Nail in SW side 4" Maple AZ. 315 deg 3.24'
Set Ottawa County Remon Tag & Nail in S side 12" Wild Cherry AZ. 260 deg 36.24'

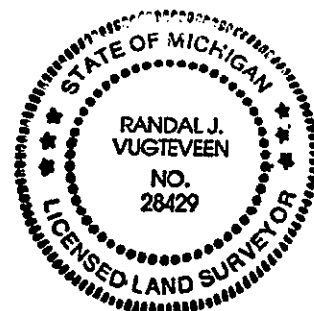

Signed by *Randal J. Vugteveen*
Surveyor's Michigan License No. 28429

Date Dec 12, 1994