

**SURVEY &  
REMONUMENTATION**

**OTTAWA COUNTY REMONUMENTATION**

OCT 07 1996

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE**

**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in OTTAWA

(County)	Located In:		Corner Code #/
	6N	13W	
1. Public Land Survey	T _____	R _____	M-2 (E 1/4 cor Section 1) Georgetown Twp
	T _____	R _____	
	T _____	R _____	
	T _____	R _____	
2. Property Controlling in Section	S _____	T _____	R _____
	S _____	T _____	R _____
3. Miscellaneous Property in Sec.	S _____	T _____	R _____
	S _____	T _____	R _____

**RECORDED**

96 AUG 26 PM 2:00

*Randy J. Vugteveen*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

**Register of Deeds Stamp & File Number**

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Randal J. Vugteveen in a field survey on January 4, 1996  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

M-2 Common corner to Section 6-6-12  
1837 - Sibley  
Set 1/4 post  
W. Oak 25N 33W 92  
W. Oak 25S 33W 82

Liber 4, Page 292  
PK nail in MBT Pole N45E 43.52'  
PK nail in P Pole S40E 53.00'  
Nail & Tag in Guy Pole S20W 70.42'

Liber 3, Page 159  
T. pole N45E 43.5'  
NW corner hse fndn S45E 77.60'  
Guy Pole S15W 70.6'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

Found KCRM @ centerline "X" Kenowa & Riverbend East and accepted as a careful and faithful perpetuation of the position of the original corner  
PK nail in P. pole S40E 53.00'  
PK nail in guy pole S20W 70.5'


NW corner house foundation S45E 77.58  
PK in West side guy pole S15W 70.5'

This corner has been held as common with A-2,  
T6N, R12W, Kent County, per Liber 4, Page 292

PA. 345 OTTAWA COUNTY  
PEER APPROVED 5-20-96

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

M-2 Kent County Harrison Monument  
NW foundation corner house #4790 Az. 146 deg 77.58'  
Set Ottawa County Remon Nail & Tag above KCRM nail & tag in NW side 24" Hickory Az. 64 deg 54.01'  
Set Ottawa County Remon Nail & Tag above PK nail in NE side pp Az. 151 deg. 53.05'  
Set Ottawa County Remon Nail & Tag above KCRM nail & tag in NW side 24" maple Az. 220 deg. 89.60'  
Set Ottawa County Remon Nail & Tag above KCRM nail & tag in NE side 30" Walnut Az. 322 deg 82.96'

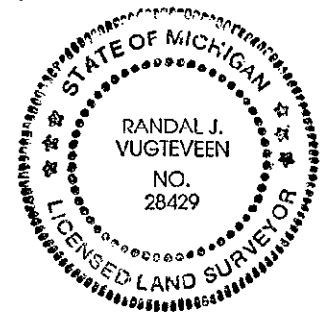

Signed by Randal J. Vugteveen

Date MAY 20, 1996

Surveyor's Michigan License No. 28429