

**SURVEY & REMONUMENTATION**

APR 24 1995

OTTAWA COUNTY REMONUMENTATION

**COMMISSION**

LAND CORNER RECORDATION CERTIFICATE

RECORDED

For corners in

Filing Requirement of Act 74, Mich. P.A. 1970

94 DEC 15 AM 11:45

<u>Ottawa</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T6N R15W	K-4
	T R	(West 1/4, Sec.
	T R	12, Olive Twp.)
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

*Rhonda K. Redmond*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Douglas J. Koning, in a field survey on December 9, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3,4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/of subsequent restoration:

K-4 Government Notes L.C.R.C. Liber 3, Page 153 January 1977  
Set Post May 1832 K-4 Cast Iron Monument Midway on line  
By Calvin Britain D.S. 16" Oak SSW 198.50'  
Maple 6" South 60 Links Pwr. pole SSE 112.97'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

K-4 Found C.I.M.  
Midway and 0.11' West of line  
Score in 28" oak SSW 198.2'

P.A. 345 OTTAWA COUNTY


PEER APPROVED

*12/12/94*  
*Richard D. Hedwell*

This marker is accepted as a careful and faithful perpetuation of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

K-4 Cast Iron Monument (Top Broken)(1'± West of Centerline, 1' Deep)  
Set O.C. Remon Nail & Tag in Wly side Pwr. pole N15°E 146.45'  
Set O.C. Remon Nail & Tag in Wly side Pwr. pole S10°E 206.06'  
Set O.C. Remon Nail & Tag in Ely side 28" Oak S10°W 198.59'  
Set O.C. Remon Nail & Tag in Sly side 10' Tree N70°W 31.30'

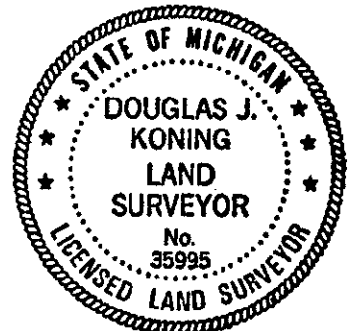

Signed by *Douglas J. Koning*  
Surveyor's Michigan License No. 35995

Date December 12, 1994