

**SURVEY & REMONUMENTATION**

APR 24 1995

COMMISSION

**OTTAWA COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

RECORDED

94 DEC 14 AM 9:43

*Phyllis Dickman*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

For corners in

Ottawa (County) Located In: \_\_\_\_\_ Corner Code ## \_\_\_\_\_

1. Public Land Survey T 6N R 16W G-9 NW Cor  
T \_\_\_\_\_ R \_\_\_\_\_ Sec 27  
T \_\_\_\_\_ R \_\_\_\_\_ Port Sheldon Twp.  
T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	16		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, John P. Clapp, in a field survey on December 3, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

<b>G-9 Govt Land Office Survey Notes</b> 1832-Surveyor, Calvin Britain Set Corner 36" Hemlock S56°E 20 links 30" Beech N56°W 38 links	<b>G-9 Recorded in Liber 1,</b> Page 315, Apr 7, 1972 Fd conc mon from witnesses Power Pole W 94.10' Tri Cherry SE 102.92' 10" Cherry SW 68.39' Fences E & S Fence Post SW 53.03'	<b>G-9 Recorded in Liber 2</b> Page 507, July 1, 1974 Fd Angle Iron at Fence Int. Power Pole W 94.10' Tri Cherry SE 101.95' 10" Cherry SW 67.65' 6" Cherry NW 20.70' 6" Pine E 18.00'
---	--	--

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

**G-9**  
Found 1/2" x 3' long capped steel bar and accepted it as a careful and faithful perpetuation of the position of the original corner

Found Nail & Cap in E Side 8" Triple Cherry	AZ 349°	20.78'
Found Nail & Cap in N Side 12" Pine	AZ 86°	18.93'
Found Nail & Cap in SE Side Tri Cherry	AZ. 157°	103.20'
Found Nail & Cap in 12" Cherry Clump	AZ. 190°	68.44'
Found Nail & Cap in N Side Power Pole	AZ. 263°	94.21'
Found Steel Bar & Cap	AZ. 270°	93.43'

**P.A. 345 OTTAWA COUNTY**  
**PEER APPROVED 12/12/94**

*Richard P. Nedewell*


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

**G-9**

Set O.C. Remon Iron & Cap		
O.C Remon Tag & Nail in S Side Power Pole	AZ 263°	94.14'
O.C Remon Tag & Nail in W Side Cherry Cluster	AZ. 190°	68.12'
O.C. Remon Tag & Nail in E Side 12" Pine	AZ. 165°	97.67'
O.C. Remon Tag & Nail in S Side 12" Pine	AZ. 86°	18.96'
O.C Remon Tag & Nail in E Side 6" Triple Maple	AZ. 354°	27.18'

Signed by John P. Clapp *John P. Clapp*  
Surveyor's Michigan License No. 14091

Date Dec. 6, 1994

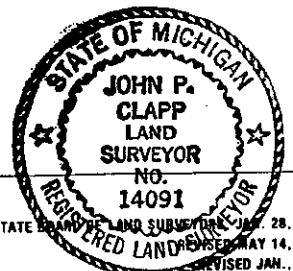

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JULY 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983