

SURVEY & REMONUMENTATION

APR 24 1995

COMMISSION

OTTAWA COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

94 DEC 14 AM 9:43

Register of Deeds
REGISTER OF DEEDS
OTTAWA COUNTY, MI

For corners in

<u>Ottawa</u> <small>(County)</small>	Located In:	Corner Code #
1. Public Land Survey	T <u>6N</u> R <u>16W</u>	<u>K-2 W1/4 Cor.</u>
	T _____ R _____	<u>Sec 1</u>
	T _____ R _____	<u>Port Sheldon Twp.</u>
2. Property Controlling in Section	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Register of Deeds Stamp & File Number

I, John P. Clapp, in a field survey on December 3, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-2 Govt Land Office Survey Notes
1832-Surveyor, Calvin Britain
Set 1/2 mile post
7" Hemlock S30°E 8 links
10" Beech N80°W 6 links

K-2 Recorded in Liber 2,
Page 569, Sept 2, 1974
Found angle iron, iron pipe and bricks
Set cast iron monument
24" Pine SSW 51.98'
8" Pine SW 57.64'
Telephone Pole NW 33.73'
CL Street Sign NE 31.44'
30" Oak SE 54.38'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Richard P. Newell
PA. 345 OTTAWA COUNTY
PEER APPROVED 12/12/94

K-2

Found cast iron monument in monument box and accepted it as a careful and faithful perpetuation of the position of the original corner.

Found Nail & Tag in N Side 30" White Pine	AZ 197°	51.74'
Found Nail & Tag in NE Side 12" Pine	AZ 236°	57.58'
CL Street Sign	AZ. 41°	40.03'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


K-2

Found Cast Iron Monument in Monument Box

O.C. Remon Tag & Nail NNW Side 36" Oak	AZ. 80°	181.57'
O.C. Remon Tag & Nail WSW Side 18" White Pine	AZ. 152°	100.51'
O.C. Remon Tag & Nail WNW Side 30" White Pine	AZ. 197°	53.06'
O.C. Remon Tag & Nail NE Side 10" Pine	AZ. 304°	74.69'

Signed by John P. Clapp
Surveyor's Michigan License No. 14091

Date Dec. 6, 1994

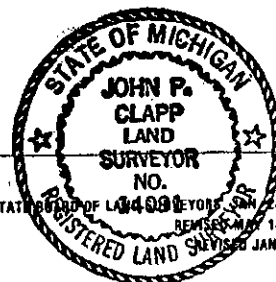

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 29, 1971
REVISED MAY 14, 1975
REGISTERED LAND SURVEYOR JAN., 1983