

SURVEY & REMONUMENTATION

DEC 01 1993

COMMISSION

For corners in

Ottawa (County)

Located In:

Corner Code #

- | | | |
|------------------------------------|----------------------------------|------------------------------|
| 1. Public Land Survey | T 6N R 16W | M-9 (NE- Sec 25) |
| | T _____ R _____ | Port Sheldon Twp: |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

RECORDED

93 NOV 11 AM 11:56

David R. Greer
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

I, David R. Greer, in a field survey on September 13, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Recorded in Liber 4 Page 336, Sept. 24, 1982

M-9

Set Cast Iron Monument

- | | | |
|-----------------|----|-------|
| Street Sign | W | 22.09 |
| Guy Pole | SE | 63.15 |
| Pipeline Marker | SW | 63.15 |
| Tele. Pole | W | 38.80 |
| Olive Twp Cor | S | 21.04 |

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-9

Found cast iron monument in monument box and accepted it as a careful and faithful perpetuation of the position of the original corner

- | | | |
|-----------------|----|-------|
| Street Sign | W | 22.09 |
| Guy Pole | SE | 63.15 |
| Pipeline Marker | SW | 63.15 |
| Tele. Pole | W | 38.80 |
| Olive Twp. Cor | S | 21.04 |


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-9

Raised C.I.M. in monument box with O.C. Remonument Iron & Cap

AZ - Michigan State Grid Direction

- | | | | |
|--|-----|---------|---------|
| O.C. Remon tag & nail in S Side P. Pole | AZ. | 270°18' | 38.91' |
| O.C. Remon tag & nail in E Side 8" Cherry | AZ. | 160°05' | 124.94' |
| Found Nail in W Side P. Pole | AZ. | 341°48' | 129.73' |
| Found Nail in Washer - 14091 in NE Side P Pole | AZ. | 138°24' | 63.12' |
| Centerline Port Sheldon St Pavement | AZ. | 180°00' | 22.7' |
| A-9 T6N R15W -C.I.M. in Monument Box | AZ. | 179°10' | 21.01' |

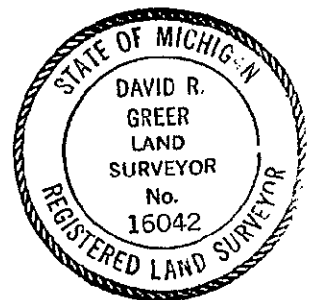

Signed by David R. Greer

Date SEPT. 13, 1993

Surveyor's Michigan License No. 16042