

APR 24 1995

Ottawa County Remonumentation

RECORDED

COMMISSION

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

94 DEC 15 AM 11:48

*D. J. ...*  
 REGISTER OF DEEDS  
 OTTAWA COUNTY, MI

For corners in

Ottawa (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>7N</u> R <u>13W</u>	<u>E-5</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

Maurice J.  
 Rosema

Nov. 26 94

I, \_\_\_\_\_, in a field survey on \_\_\_\_\_, 19 \_\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

E-5  
 GLO - 1838 by Joiner - 1991 per L.C.R.C.  
 R. Whitcomb C.I. mon.  
 Set post Steel post - E. 2.02'  
 24" Beech - S71°W .12 ch. P.K. nail in wood post - W. 37.67'  
 24" Walnut - N45°E .34 ch. Steel post - S. 0.54'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


E-5  
 Found C.I. mon.  
 Centerline of steel fence post - S90°E 2.03'  
 Centerline of steel fence post - S0°E 0.47'  
 Found P.K. nail in S. side wood fence post - N89°W 37.46'

I hereby accept this corner as a correct and accurate perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-5  
 C.I. mon.  
 Set nail and remon. tag in S. side wood fence post - N89°W 37.64'  
 Set nail and remon. tag in SE. side 24" Ash - N29°E 334.96'  
 Set nail and remon. tag in E. side 15" Maple - N5°E 222.50'  
 Set nail and remon. tag in SW. side 12" Aspen - N37°W 207.61'  
 E.-W. wire fence - N. 0.3'

P.A. 345 OTTAWA COUNTY  
 PEER APPROVED 12/12/94  
*Kendry D. Nedewell*

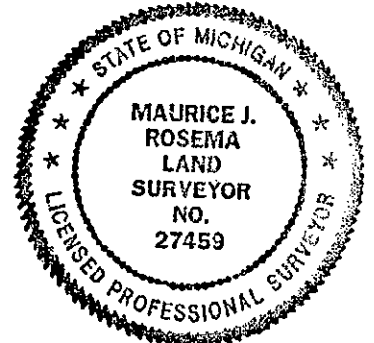

Signed by *Maurice J. Rosema* 27459  
 Surveyor's Michigan License No. \_\_\_\_\_

Date Dec. 10, 1994