SURVEY &
REMONUMENTATION

DEC 01 1998

SECTION

Ottawa County Remonumentation

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Ottawa
(County)

RECORDED
98 JUL 24 PM 1:47
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

	Located In:		Corner Code #
	7N	14W	E-1
1. Public Land Survey	T___	R___	NW cor. Sec. 4
	T___	R___	Polkton Twp
	T8N	R14W	E-13
	T___	R___	
2. Property Controlling	S___ T___	R___	
in Section	S___ T___	R___	
3. Miscellaneous	S___ T___	R___	
Property in Sec.	S___ T___	R___	

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

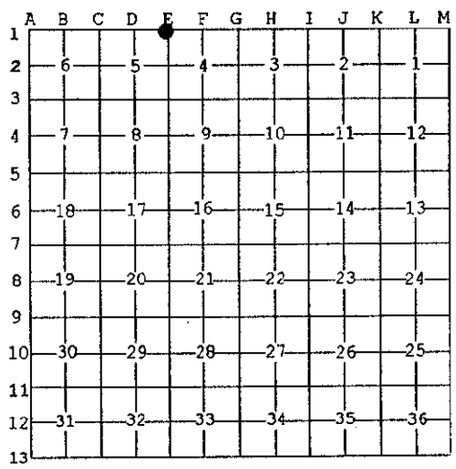

I, Maurice J. Rosema, in a field survey on Jan. 28, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-1

GLO survey notes - 1837
by surveyor Mullett
post
8" Leym - S 19°E 8 links
14" Hemlock - S58°W 33 links

LCRC rec. in Liber 3, Page 677
(1997 by Vugteveen) - over
(rec. as E-13, T8N, R14W)

LCRC rec. in Liber 5, Page 335
(1988 by Rosema)
C.I. mon.
nail and tag in N side 18" Hemlock - ESE 78.66'
nail and tag in W side 18" Oak - SE 60.84'
nail and tag in E side 12" Ash - NNE 41.50'
nail and tag in S side 8" Elm - NW 54.45'
centerline of E-W road - S 3'
centerline of N-S CMP - W 113'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-1

Found C.I. mon. in mon. box 0.8' below road surface
Found nail and remon. tag in N side 18" Hemlock - SE 60.80'
Found nail and remon. tag in W side 13" Oak - NE 41.51'
Found nail and remon. tag in W side 12" Maple - N 49.00'
Found nail and remon. tag in NE side 20" Pine - ESE 78.74'
Centerline of E-W gravel road - S 3'

Found nail and tag in N side 18" Hemlock - SE 60.81'
Found nail and tag in E side 13" Ash - NE 41.54'

P.A. 345 OTTAWA COUNTY
PEER APPROVED 6-15-98

I hereby accept the position of the C.I. mon. as a careful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-1

C.I. mon. in gravel road
Found nail and remon. tag in N side 18" Hemlock - S48°E 60.80'
Found nail and remon. tag in W side 13" Ash - N25°E 41.51'
Found nail and remon. tag in W side 12" Maple - N1°W 49.00'
Found nail and remon. tag in NE side 20" Pine - S60°E 78.74'
Centerline of E-W gravel road - S 3'
This corner is common with E-13, T8N, R14W

STATE OF MICHIGAN
MAURICE J. ROSEMA
LAND SURVEYOR
NO. 27459
LICENSED PROFESSIONAL SURVEYOR

Receipt #5013 $11.00 CORNER

Signed by Maurice J. Rosema
Surveyor's Michigan License No. 27459

Date June 13, 1998

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995

SURVEY &
REMONUMENTATION

DEC 01 1998

SECTION

LCRC per Liber 3, Page 677 (recorded as E-13, T8N, R14W)
C.I. mon.
nail and OC remon. tag in Sw side 22" Oak - AZ 132° 60.68'
nail and OC remon. tag in NE side 21" Hemlock - AZ 119° 78.59'
nail and OC remon. tag in SE side 13" Oak - AZ 23° 41.54'
nail and OC remon. tag in W side 12" Oak - AZ 353° 48.94'
Centerline of Hayes - S 3'
F-13, T8N, R14W - E 2688.83'