

**SURVEY &  
REMONUMENTATION**

DEC 1 6 1996

COMMISSION

**OTTAWA COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Ottawa</u> (County)	Located In:	Corner Code #
	Robinson Township	
1. Public Land Survey	T <u>7N</u> R <u>15W</u>	<u>M-11</u>
	T ___ R ___	<u>NE corner</u>
	T ___ R ___	<u>Section 36</u>
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

**RECORDED**  
96 NOV 14 AM 11:21  
*Robert Chittman*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI.  
**Register of Deeds Stamp & File Number**

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Carl P. Englert, in a field survey on 9/10, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		13		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-11 Section corner common to Sections 25 & 36  
G.L.O. 1837 by John Mullett LCRC Liber 1, Page 525 7/13/1972  
Set corner to Sections 25 & 36 1/2" Iron pipe  
Elm 20" S71°W 36 links 3" Ash N.W. 37.90'  
W. Ash 20" N52°W 41 links 16" Elm N.E. 40.00'  
See other side 14" W. Ash S.E. 28.90'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


M-11 Section corner common to Sections 25 & 36  
Found 4" Cast Iron Monument in Mon. Box  
Found N.E. Cor. Bridge S.S.E. 90.29'  
Found N.W. Cor. Bridge S.S.W. 90.24'  
Found  $\square$  St. Sign S.W. 41.2±

P.A. 345 OTTAWA COUNTY  
PEER APPROVED 9-16-96  
*G.P.N.*

Accepted as a careful and faithful perpetuation of the original position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-11 Section corner common to Sections 25 & 36  
4" Cast Iron Monument in Mon. Box on centerline of pavement  
O.C. Remon tag & nail in N. Side P.P. S86°W 269.87'  
O.C. Remon tag & nail in N.E. Side 13" Ash N52°W 73.89'  
O.C. Remon tag & nail in N. Side P.P. S72°E 77.80'  
O.C. Remon tag & nail in E. Side 36" Maple S13°W 160.98'  
Allendale corner South 8.54'

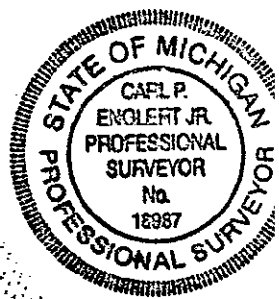

Signed by Carl P. Englert Jr.  
Surveyor's Michigan License No. 18987

Date 9/16/1996

SURVEY &  
REMONUMENTATION

DEC 1 6 1996

COMMISSION

M-11 Section corner common to Section 25 & 36  
LCRC Liber 4, Page 80  
Fd 3/4" Iron Pipe Set Cast Iron Monument  
P.P. E.S.E. 77.53'  
N.E. Cor. bridge S.S.E. 90.29'  
N.W. Cor. bridge S.S.W. 90.24'  
Q. St. Sign S.W. 41.20'  
Tw 11" Maple W.S.W. 65.14'  
Allendale corner South 8.54'