

DEC 01 1993

COMMISSION

OTTAWA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

93 NOV 11 AM 11:54

Elizabeth Callman
REGISTER OF DEEDS
OTTAWA COUNTY, MI

For corners in

Ottawa (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>8N</u> R <u>13W</u>	I-8 (E 1/4, 22) Wright Twp.
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Donald W. Schiele, in a field survey on November 2, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

I-8 corner common to Sections 22 and 23 Wright Twp.
L.C.R.C. recorded in Liber 2, Page 663, 10-21-74.
Iron in Monument Box
NE Corner Hse Fndn. W-SW. 79.14'
Spike in 18" Maple SE. 62.12'
P.K. Nail in Fence Post E. 30.90'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


I-8 Found 1/2" Iron Pipe in Monument Box and accepted as a careful and faithful perpetuation of the position of the original corner.
NE Corner Garage Fndn., House # 16395 WSW 79.11'
Face of Fence Post East 30.96'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-8 Set 3/4" X 24" solid bar with Ottawa County Remon Cap in Monument Box in place of 1/2" Iron Pipe.
Set Ottawa County Remon Tag & nail in West side of Power Pole N 7°E 288.83' (E)
Set Ottawa County Remon Tag & nail in North side of Corner Fence Post N89°E 31.27'
Set Ottawa County Remon Tag & nail in SE side 16" Maple S33°W 77.20'
NE Corner Garage Fndn. to House # 16395 S71°W 79.11'
Set Ottawa County Remon Tag & nail in North side of Power Pole S81°W 128.28' (E)
Centerline North and South asphalt road 2' West
On Fence Line to East
On Occupation Line to West

Signed by Donald W. Schiele
Surveyor's Michigan License No. 23517

Date Nov. 8, 1993

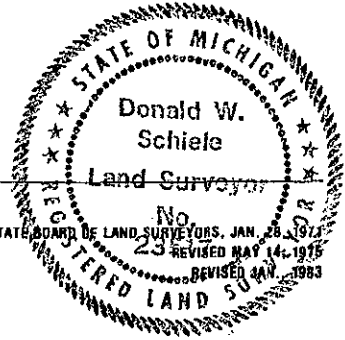

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1975
REVISED MAY 14, 1975
REVISED JAN. 1983