

**SURVEY &
REMONUMENTATION**

DEC 01 1998

**OTTAWA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

RECORDED

98 JUL 21 PM 12:14

SECTION

For corners in

<u>Ottawa</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 8N R13W	J-3 (N¼, 11)
	T ___ R ___	Wright Twp.
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Greg Schiele
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Donald W. Schiele, in a field survey on June 10, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3									●			
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

J-3 1/4 corner common to Sections 2 & 11, Wright Twp.
Original Government Corner Record: From Consumers Power Co. records, 1968:
Set qr sec post 1. Iron set 1.0' N of C/L 24" Oak
Post which is shown at fence corner.
R Oak 26 N15E 5 2. Distance from S1/4 cor, Sec. 2 to
Beech 8 S87W 11 SE cor, Sec. 2 = 2607.64'
Enoch Hammele, Deputy Surveyor, for Distance from S1/4 cor, Sec. 2 to
Rasselas Whitcomb, Deputy Surveyor Central 1/4 cor, Sec. 2 = 2640.20'
Between 9-18 & 9-26, 1838

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-3 Found Consumers Power Co. "T" Iron, laying on ground by downed 30" Twin Oak at fence corner.
Rejected as 1/4 corner common to Sections 2 & 11. The fence line to the South, which the corner placement was based upon, does not follow the North & South 1/4 line of Section 11, as then established, but meanders Southeasterly 668'± to a fence corner that would be 17' East of the 1/4 line. Established 1/4 corner common to Sections 2 & 11 by single proportionate measurement, and accepted as a careful and faithful reestablishment of the position of the original corner.

PEER APPROVED

6-15-98


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-3 Set 3/4" X 36" Steel Bar with Ottawa County Remon Cap at ground level.
Set Ottawa County Remon Tag & nail in North side of 6" Ash S81°E 28.42'
Set Ottawa County Remon Tag & nail in SW side of 16" Ash S33°E 37.41'
Set Ottawa County Remon Tag & nail in East side of 9" Twin Maple South 17.22'
Set Ottawa County Remon Tag & nail in North side of 16" Maple S76°W 38.08'
East & West fence remnants, 2'± South.
30" Twin Oak (down), fence remnants South and
Consumers Power Co. "T" Iron (laying on ground), 13'± East.
(SEE SKETCH ON REVERSE)

Signed by Donald W. Schiele

Date 6-15-1998

Surveyor's Michigan License No. 23517

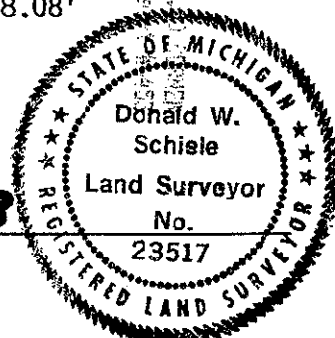

SURVEY &
REMONUMENTATION

DEC 01 1998

SECTION

