

**SURVEY &  
REMONUMENTATION**

APR 05 1996

**OTTAWA COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **COMMISSION**  
Ottawa  
(County)

	Located In:	Corner Code #
1. Public Land Survey	Polkton Twp T 8 N R 14 W	A - 4 W 1/4 Corner Section 7
2. Property Controlling in Section	S T R	Common corner w/ M-4, Crockery Twp.
3. Miscellaneous Property in Sec.	S T R	

**RECORDED**

95 NOV 15 PM 2:06

*Regina Holman*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Carl P. Englert, Jr., in a field survey on October 9, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

A - 4 1/4 corner common to Section 7, T 8 N, R 14 W & Section 12, T 8 N, R 15 W.  
Original corner set March 1837 LCRC Liber 2, Page 67  
by John Mullett D.S. February 15, 1973.  
Set 1/4 Section Post Fd. Bent Iron Pipe, Set 5/8" Rod  
Sugar 13" S 32° W 5 Links NW 36.70' Tw Maple  
Elm 12" N 21° W 11 Links NE 63.67' 8" Ash  
NE 24.80' 6" Ash  
SE 47.28' 12" Ash

see other side

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

A - 4 1/4 corner common to Section 7, T 8 N, R 14 W & Section 12, T 8 N, R 15 W.  
Found 4" CIM 10" deep in CL of Gravel Road  
Found nail in top of fencepost E. 30.30'± (Post Leaning)  
Found 18" Twin Basswood (Ash) WNW 37.33'  
Found 6" Elm SW 41.45'

Accepted as a careful and faithful perpetuation of the position of the original corner.

P.A. 345 OTTAWA COUNTY

PEER APPROVED 10/23/95


*Don Hudson*

**C. Description of monument for corner and accessories established to perpetuate the position of the corner:**

A - 4 1/4 corner common to Section 7, T 8 N, R 14 W & Section 12, T 8 N, R 15 W.  
4" CIM  
Ottawa County Remonumentation Tag and Nail in W. side 6" Maple S 15° E 135.67'  
Ottawa County Remonumentation Tag and Nail in SE side 6" Elm S 41° W 41.45'  
Ottawa County Remonumentation Tag and Nail in N side 18" Tw Basswood N 64° W 37.69'  
Ottawa County Remonumentation Tag and Nail in E side 24" Maple N 24° W 66.18'  
Ottawa County Remonumentation Tag and Nail in W side 6" Ash N 16° E 83.34'

Signed by Carl P. Englert Jr.  
Surveyor's Michigan License No. 18907

Date 10/17/1995

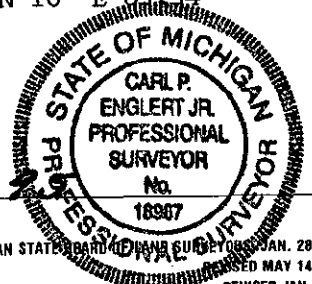

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983

A - 4 Polkton Twp. T 8 N, R 14 W  
M - 4 Crockery Twp. T 8 N, R 15 W  
LCRC Liber 4, Page 98 August 12, 1980  
Found Iron Bar, Set CIM  
Nail in top of Fence post East 30.30'  
Tw. 16" Maple NW 64.66'  
18" Ash WNW 37.33'

\$ 11.00 CORNER