

SURVEY &  
REMONUMENTATION

APR 05 1996

OTTAWA COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE

COMMISSION Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

95 DEC 12 AM 11:50

*Robert K. Hillman*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI.

For corners in <u>Ottawa</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T8N R14W	F-7
	T _____ R _____	S 1/4 cor. Sec.
	T _____ R _____	16, Polkton Twp.
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Steven Lampen, in a field survey on November 15, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

F-7		
GLO Survey Notes	LCRC L 2-P 767	LCRC L 6-P 53
1837, Surveyor - John Mullett	May 5, 1975	Oct. 12, 1990
Set post	Found R.R. spike in pavement	Found R.R. spike, Set cast iron monument
10" Elm S 59° W 23 links	Gas line marker SW 47.60'	8" Elm N 50.40'
30" Maple N 67° E 23 links	Gas line marker NW 45.70'	8" Poplar ENE 99.48'
	12" Willow N 5° W 53.79'	Gas pipeline sign NW 56.10'
	Fence post N 40.5'	

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-7  
Found cast iron monument and accepted it as a careful and faithful perpetuation of the position of the original corner.


8" Elm N 50.40'  
8" Poplar ENE 99.48'  
Gas pipeline sign NW 56.10'

P.A. 345 OTTAWA COUNTY  
PEER APPROVED 11/20/95

*Robert D. Hedewell*  
S.D.M.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-7  
Cast iron monument  
Set O. C. Remonumentation tag & nail in S side 16" Elm N 69° W 108.34'  
Set O. C. Remon. tag & nail in W side 24" Maple N 07° E 54.23'  
Set O. C. Remon. tag & nail in SE side 10" twin Elm N 36° E 46.79'  
Set witness iron & cap #37279 S 60° E 30.72'  
Set witness iron & cap #37279 S 64° W 30.87'

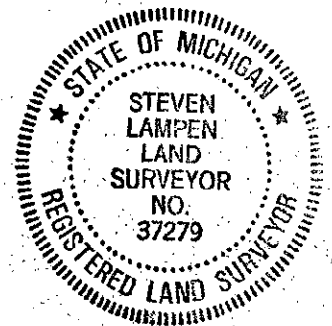

Signed by Steven Lampen

Date November 17, 1995

Surveyor's Michigan License No. 37279