

RECORDED

93 DEC 15 AM 9:27

OTTAWA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ottawa
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 8N R 14W F-9 (N $\frac{1}{2}$, 28)
T _____ R _____ Polkton Twp.
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

Dep. # 1 pm

Elizabeth Robinson
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Donald W. Schiele in a field survey on December 1, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

F-9 corner common to Sections 21 & 28, Polkton Twp.	L.C.R.C. recorded in Liber 2, Page 499, 5-29-74	L.C.R.C. recorded in Liber 4, Page 211, 6-25-81	L.C.R.C. recorded in Liber 5, Page 283, 11-30-87
Iron	C.I.M.	1/2" re-rod	
Power Pole SE 72.49'	Power Pole SE 72.47'	Nail & tag in fc P pole SE 72.62'	
Street Sign N 24.08'	Sign North 19.14'	Centerline st sign SW 49.84'	
Underground Phone	Telephone	Centerline Tele ped SW 57.85'	
Stanchion SW 57.06'	Pedestal SW 57.93'	PK nail in E side	
	Street Sign SW 49.61'	wood post	NNE 19.74'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-9 Found 1/2" X 18" re-rod 2" below surface over Cast Iron Monument with top broken off, and accepted as a careful and faithful perpetuation of the position of the original corner.

Centerline Sign	North	19.90'
Found PK nail in SE side of wood post leaning NNW	NNE	19.90'
Found nail & tag in NW side of Power Pole	SE	72.58'
Centerline Telephone Pedestal	SW	57.99'
Centerline Street Sign	SW	49.76'


Donald W. Schiele

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-9 Set 3/4" X 36" solid bar with Ottawa County Remon Cap 7" below surface in place of 1/2" X 18" re-rod and broken Cast Iron Monument.

Chiseled "X" on Northerly end of 18" Concrete Culvert	N02°E	25.48'
Set Ottawa County Remon Tag & nail in NE side of Power Pole	S40°E	73.05'
Set Ottawa County Remon Tag & nail in SE side of Power Pole	S63°W	129.40'
Set Ottawa County Remon Tag & nail in SW side of 3" Elm	N13°W	55.97'
Centerline ditch to North, 5' West		
Centerline gravel road to South, 5' West		
On centerline asphalt road to East		
On centerline gravel road to West		

Signed by Donald W. Schiele Date DEC. 6, 1993
Surveyor's Michigan License No. 23517

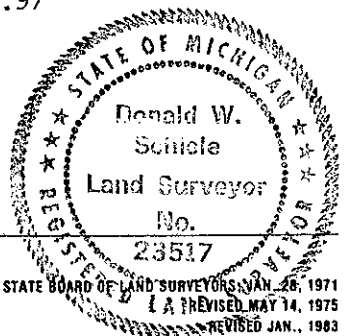

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
LA REVISED MAY 14, 1975
REVISED JAN., 1983