

**SURVEY &
REMONUMENTATION**

MAR 08 1994

COMMISSION

**OTTAWA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

RECORDED

93 NOV -8 PM 1:58

Dorothy Robinson
REGISTER OF DEEDS
OTTAWA COUNTY, MI

For corners in

<u>Ottawa</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>8N</u> R <u>14W</u>	<u>G-4 (W. 1/4, 10)</u> <u>Polkton Twp.</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Donald W. Schiele in a field survey on October 15th, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-4 corner common to Sections 9 and 10 Polkton Twp.
L.C.R.C. recorded in Liber 4, Page 111, 10-14-80
C.I.M. Inscribed "Section Corner"
Buried Tele. Cable Sign East 23.19
Nail in Wood Fence Post NE. 115.50

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


G-4
Found C.I.M. Inscribed "Section Corner" and accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-4
C.I.M. 7" below surface
Set Ottawa County Remon Tag & nail in West side of 10" Quad Maple N13°E 131.11' (E)
Southwest corner of Poured Concrete Building N52°E 183.94' (E)
Set Ottawa County Remon Tag & nail in South side of Power Pole S90°W 115.97' (E)
Set Ottawa County Remon Tag & nail in East side of 28" Maple N7°W 233.39' (E)
On occupation line to West
CL of North and South gravel road 1' West

Signed by Donald W. Schiele
Surveyor's Michigan License No. 23517

Date 10-18-93

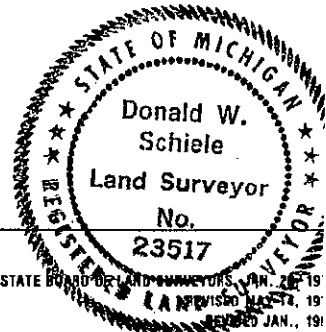

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 2, 1979
REVISED JAN., 1991