

**SURVEY &  
REMONUMENTATION**

APR 25 1995

**COMMISSION**

**OTTAWA COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

94 DEC -8 PH 12:37

*Phyllis Kellman*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

corners in

<u>Ottawa</u> (County)	Located In:	Corner Code: <u>++</u>
	<u>Crockery Twp.</u>	
Public Land Survey	T <u>8N</u> R <u>15W</u>	<u>K-3</u>
	T _____ R _____	<u>NE Corner</u>
	T _____ R _____	<u>Section 11</u>
	T _____ R _____	_____
Property Controlling	S _____ T _____ R _____	_____
in Section	S _____ T _____ R _____	_____
Miscellaneous	S _____ T _____ R _____	_____
Property in Sec.	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

Carl P. Englert, in a field survey on March 16, 1994, hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the present manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as pressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

Description of original monument and accessories and/or subsequent restoration:

**K-3 Corner Common to Sections 1,2,11, and 12.**

Original gov't corner set March, 1837  
by John Mullet  
Hemlock 6" at corner  
Beech 10" S85°W 12 links

LCRC Liber 4, Page 95 (8/13/80)  
Fd. 1" Pipe Set C.I.M.  
15" Pine N.W. 84.64'  
13" Pine N.E. 57.02'  
36" Tree S.W. 49.06'  
9" Sassafras S.E. 54.10'

See Back of Page

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

**K-3 corner common to Sections 1,2,11 and 12.**

Found 4" Harrison Cast Iron Monument  
Found 13" Pine N.E. 57.02'  
Found 36" Tree S.W. 49.06'  
Found 10" Pine N.W. 44.02'

**P.A. 345 OTTAWA COUNTY**  
**PEER APPROVED** 11/21/94


*Kudoy P. Hedewald*

Accepted as a careful and faithful perpetuation of the position of the original corner.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

**K-3 Corner common to Section 1,2,11 and 12.**

4" Harrison Cast Iron Monument 6" deep, placed mon. box.  
O.C. Remon. Tag & Nail in W. side 16" Red Pine N46°E 57.57'  
O.C. Remon. Tag & Nail in S.W. side 7" White Pine S37°E 60.18'  
O.C. Remon. Tag & Nail in S.E. side 7" White Pine S40°W 72.32'  
O.C. Remon. Tag & Nail in N.E. side 26" White Pine N65°W 43.81'  
Capped Iron West 33.00'

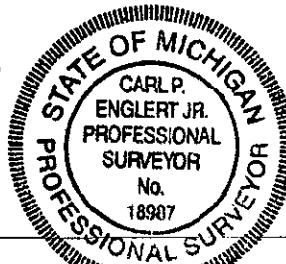

Signed by Carl P. Englert Jr. Date 11/17/94  
Surveyor's Michigan License No. 18907

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983

A. Description of original monument and accessories and/or subsequent restoration.

K-3 LCRC Liber 2, Page 251 (8/6/73)

Fd. 1" Pipe

N.W. 10" Pine 44.02'

N.E. 8" Pine 34.4'

S.W. 36" Tree 49.06'

S.E. 8" Ash 48.51

COPIE #  
CORRECT  
COPIE #  
FROM