

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ontonagon

(County)

Located in:

Corner Code #

1. Public Land Survey

T 46N R 39W K1

T _____ R _____ _____

T _____ R _____ _____

T _____ R _____ _____

2. Property Controlling in Section

S 1 T 46N R 39W 10

S _____ T _____ R _____ _____

3. Miscellaneous Property in Sec.

S _____ T _____ R _____ _____

S _____ T _____ R _____ _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

10 Sep 23 1997

K1 Sep 29 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		11		12		13		14		15	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(K1) Corner common to Sections 1-2 T46N-R39W and Sections 35-36 T47N-R39W. Corner monumented in 1986 by R.L. Drahn RLS #21564. Recorded in Liber 3 Page 26, Ontonagon County Record.

(10-Sec. 1) South 1/16 corner between Sections 1 and 2. Corner previously recorded in 1991 by Joseph W. Lett, RLS #21576 in Liber 3 Page 152, Ontonagon County Record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K1) Found the 1986 monument and accessories in good condition and as described in the previous record. The 1986 Maple NE was found cut down above the 8H blaze but is still alive. The Spruce NW was cut down above the measuring nail to facilitate GPS observations at the corner. Made two new replacement accessories as described below. This corner is being recorded in order to update the witnesses. Corner re-witnessed by B.Wheeler and D.Lampela, Baraga District Office.

(10-Sec.1) Recovered Lett's 1991 witnesses and corner position and found his position marked not with a pipe, as in the record, but with a steel spike. A retracement of Section 1, including the Lett 1991 survey revealed that the 1991 survey was erroneous on several counts. I rejected this monument as representing the position of the corner. Established the corner midway and on a line of mean true bearing between 1/4 corner 1325.12'M and Section corner 1325.12' South. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office. From the corner monumented, the found spike bears N09E 1.25' distant.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K1) Found 2" dia. aluminum monument with 3 1/4" dia. aluminum cap #21564.

Blazed and scribed the following:

4" Maple S69W 45.5' "S2 NBT"

8" Maple N70E 34.0' "S36 NBT"

Bearings are magnetic. Distances are to notch in lower blaze.

(10) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:


8" W. Pine N66W 59.1' "1/16S BT"

6" Maple (S'yly of two) N06W 62.6' do

7" Maple (N'yly of 4) N77E 27.0' do

8" Maple (in clump) S63E 42.8' do

Bearings are magnetic. Distances to notch in lower blaze. Placed squared maple post adjacent.

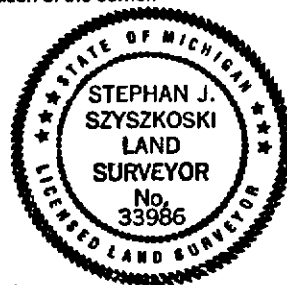

Signed by

Stephan J. Szyszkoski

Date

2/18/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division